



Digi Accelerated Linux Release Notes

AnywhereUSB Plus

Version 23.12.1.56

INTRODUCTION

This is a major firmware release for AnywhereUSB Plus products.

AnywhereUSB Plus is a Remote USB 3.1 Hub that implements USB over IP technology over Gigabit Ethernet networks. The Hub enables communication with USB-enabled devices from virtualized systems and from remote host computers. You can securely deploy AnywhereUSB Plus Remote USB 3.1 Hubs in non-secure environments, making it ideal for point-of-sale, kiosks, surveillance, industrial automation, or any mission-critical enterprise application.

The AnywhereUSB 2 Plus is a Gigabit Ethernet-attached solution that provides 2 USB 3.1 Gen 1 ports to connect a wide range of peripheral devices such as USB license dongles, scanners, printers, cameras, storage media, or other USB devices.

The 8- and 24-port models provide support for 10 Gigabit Ethernet and include SFP+ interfaces.

SUPPORTED PRODUCTS

- AnywhereUSB 2 Plus
- AnywhereUSB 8 Plus
- AnywhereUSB 8 Plus with Wi-Fi
- AnywhereUSB 24 Plus
- AnywhereUSB 24 Plus with Wi-Fi

KNOWN ISSUES

- Health metrics are uploaded to Digi Remote Manager unless the **Monitoring > Device Health > Enable** option is de-selected and either the **Central Management > Enable option** is de-selected or the **Central Management > Service** option is set to something other than Digi Remote Manager [DAL-3291]

UPDATE CONSIDERATIONS

- AnywhereUSB 2 Plus devices running 20.5.338.58 or older firmware will be reset to default settings if upgraded to 20.8.22.32 or newer firmware. Users will need to reconfigure the AnywhereUSB 2 Plus device after upgrading firmware [DAL-6649]
- Some older firmware revisions 20.x 21.x 22.x might not be able to calculate the checksum verification for a 23.x or newer firmware correctly. Please update from your 20.x 21.x or 22.x to firmware 22.11.48.10 first, reboot the USB hub then update to your final 23.x or newer firmware.

UPDATE BEST PRACTICES

Digi recommends the following best practices:

1. Test the new release in a controlled environment with your application.

To update the AnywhereUSB Plus firmware from 3.0.x to the new firmware follow these steps:

1. Software is available through [Digi Support Site](#)
2. Connect to the device's web UI by connecting your PC to the Ethernet port of the device.
3. Use the AnywhereUSB manager to find your hub and open the Web UI
4. Select the **Administration->Firmware update** on the left side of the page.
5. Select the **Choose File** button next to the **Select Firmware** section.
6. Browse for and select the downloaded firmware file.
7. Click the **Update** button.

To update the AnywhereUSB Plus firmware from 19.11.x or 20.x to the new firmware, follow these steps:

1. Download the firmware file from the [Digi firmware support page](#).
2. Connect to the device's web UI by connecting your PC to the Ethernet port of the device and then going to <http://192.168.210.1>.
3. Select the **System** tab on the top navigation bar of the page, then select **Firmware Update**.
4. Select the **Browse** button in the **Upload file** section.
5. Browse for and select the downloaded firmware file.
6. Click the **Update Firmware** button.

TECHNICAL SUPPORT

Get the help you need via our Technical Support team and online resources. Digi offers multiple support levels and professional services to meet your needs. All Digi customers have access to product documentation, firmware, drivers, knowledge base and peer-to-peer support forums.

Visit us at <https://www.digi.com/support> to find out more.

CHANGE LOG

Mandatory release = A firmware release with a critical or high security fix rated by [CVSS score](#).

For devices complying with ERC/CIP and PCIDSS, their guidance states that updates are to be deployed onto device within 30 days of release

Recommended release = A firmware release with medium or lower security fixes, or no security fixes

Note that while Digi categorizes firmware releases as mandatory or recommended, the decision if

and when to apply the firmware update must be made by the customer after appropriate review and validation.

VERSION 23.12.1.56 (December 2023)

This is a **recommended** release

Part Number	Firmware	sha512sum	md5sum
AW24-Gxxx	AnywhereUSB24-23.9.20.63.bin	3c6cae20a26596e42cb614d77c3c49c0c01845dbf4b24529a6d640a4c0b7704028c1e0b3c6450f0e5f9da69a1933e8f1907c3e992a83ceb8c92a694667665f25	4e579e74aa14255355f32a2c1e562998
AW24-Wxxx	AnywhereUSB24W-23.9.20.63.bin	7d5a6d3d4bc0a0fa94b83b94a5024e836e9d2263457ef8c01efe38c6b8c1b6d7980629bbff8c4ffb3d74e86c193ddb71366576b1b87da6b19c2fe1b996b6264e	aadf1fb8c76562e62a6852f95340c6d3
AW02-Gxxx	AnywhereUSB2i-23.9.20.63.bin	9625c9d302e40bbc96dae63da8a53e4166ea44c2e2e8d3b052406156f8043368478e2b4c7b6babdf0ad81c0df02bda1b8b6d344a8df9e99be66c73e600e22999	3ce692f8709ee7c5872df9873e8e937c
AW08-Gxxx	AnywhereUSB8-23.9.20.63.bin	a8c64afe83384efe7db77563c571a76f1b44f1bb6223c845b39b0b5866dcb9957ebcaf9d1af9cdca3df336c3512a2501075259c0e7c050ccdc9cc9ed65966d6	19f2ae49faf2dea0c536df6d105ec2a9
AW08-Wxxx	AnywhereUSB8W-23.9.20.63.bin	833204d953d98b6eba602c775bfb05aa22845dbfcf0d76558b10605baa4342462ced82345160dbdfdaf097b2c191e9be8b125627bd84ebe9a1c56981705837b	1fb5b0dd76b4aeb4f4e208e19df13b5f

ANYWHEREUSB SPECIFIC CHANGES

- Added new option under the **Services → Anywhere USB** configuration settings to control the minimum TLS version allowed by Realport (default v1.2)
- Added metrics to display in the CLI, web UI, and Digi Remote Manager metrics the status of the PSU power supplies inside the AnywhereUSB 24 Plus device

NEW FEATURES

- Support for linking OSPF routes through a DMVPN tunnel has been added.
 - A new configuration option **Point-to-Point DMVPN** has been added to **Network > Routes > Routing services > OSPFv2 > Interface > Network** parameter.
 - A new configuration parameter **redirect** has been added to the **Network > Routes > Routing services > NHRP > Network** configuration.
- Support for the **Rapid Spanning Tree Protocol (RSTP)** has been added.

ENHANCEMENTS

- The EX15 and EX15W bootloader has been updated to increase the size of the kernel partition to accommodate larger firmware images in the future. Devices will need to be updated to the 23.12.1.56 firmware before updating to newer firmware in the future.
- A new option **After** has been added to the **Network > Modems Preferred SIM** configuration to prevent a device from switching back to the preferred SIM for the configured amount of time.
- The **WAN Bonding** support has been updated
 - New options have been added to the **Bonding Proxy** and **Client devices** configuration

- to direct traffic from specified network through the internal WAN Bonding Proxy to provide improved TCP performance through the WAN Bonding server.
- b. New options have been added to set the **Metric** and **Weight** of the WAN Bonding route which can be used to control the priority of the WAN Bonding connection over other WAN interfaces.
 4. A new DHCP server option to support BOOTP clients has been added. It is disabled by default.
 5. The status of Premium Subscriptions has been added the System Support Report.
 6. A new `object_value` argument have been added to the local Web API that can be used to configure a single value object.
 7. The SureLink actions **Attempts** parameter has been renamed to the **SureLink Test failures** to better describe its use.
 8. A new **vtys** option has been added to the CLI to allow access to the **FRRouting** integrated shell.
 9. A new **modem sms** command has been added to CLI for sending outbound SMS messages.
 10. A new **Authentication > serial > Telnet Login** parameter to been added to control whether a user must supply authentication credentials when opening a Telnet connection to direct access a serial port on the device.
 11. The OSPF support has been updated to support the setting the Area ID to an IPv4 address or a number.
 12. The mDNS support has been updated to allow a maximum TXT record size of 1300 bytes.
 13. The migration of the SureLink configuration from 22.11.x.x or earlier releases has been improved.
 14. A new **System → Advanced watchdog → Fault detection tests → Modem check and recovery** configuration setting has been added to control whether the watchdog will monitor the initialization of the cellular modem inside the device and automatically take recovery actions to reboot the system if the modem doesn't initialize properly (disabled by default).

SECURITY FIXES

1. The Linux kernel has been updated to version 6.5 [DAL-8325]
2. An issue with sensitive SCEP details appearing the SCEP log has been resolved. [DAL-8663]
3. An issue where a SCEP private key could be read via the CLI or Web UI has been resolved. [DAL-8667]
4. The musl library has been updated to version 1.2.4 [DAL-8391]
5. The OpenSSL library has been updated to version 3.2.0 [DAL-8447]
[CVE-2023-4807](#) CVSS Score: 7.8 High
[CVE-2023-3817](#) CVSS Score: 5.3 Medium
6. The OpenSSH package has been updated to version 9.5p1 [DAL-8448]
7. The curl package has been updated to version 8.4.0 [DAL-8469]
[CVE-2023-38545](#) CVSS Score: 9.8 Critical
[CVE-2023-38546](#) CVSS Score: 3.7 Low
8. The frrouting package has been updated to version 9.0.1 [DAL-8251]
[CVE-2023-41361](#) CVSS Score: 9.8 Critical
[CVE-2023-47235](#) CVSS Score: 7.5 High

[CVE-2023-38802](#) CVSS Score: 7.5 High

9. The sqlite package has been updated to version 3.43.2 [DAL-8339]

[CVE-2022-35737](#) CVSS Score: 7.5 High

10. The netif, ubus, uci, libubox packages have been updated to OpenWRT version 21.02 [DAL-7749]

BUG FIXES

1. An issue with serial modbus connections that cause incoming Rx responses from a serial port configured in ASCII mode if the reported length of the packet didn't match the received length of the packet to be dropped has been resolved. [DAL-8696]
2. An issue with DMVPN that cause NHRP routing through tunnels to Cisco hubs to be unstable has been resolved. [DAL-8668]
3. An issue that prevented the handling of incoming SMS message from Digi Remote Manager has been resolved. [DAL-8671]
4. An issue that could cause a delay in connecting to Digi Remote Manager when booting up has been resolved. [DAL-8801]
5. An issue with MACsec where the interface could fail to re-establish if the tunnel connection was interrupted has been resolved. [DAL-8796]
6. An intermittent issue with the SureLink restart-interface recovery action on an Ethernet interface when re-initializing the link has been resolved. [DAL-8473]
7. An issue that prevented the Autoconnect mode on a Serial port from reconnecting until the timeout had expired has been resolved. [DAL-8564]
8. An issue that prevented IPsec tunnels from being established through a WAN Bonding interface have been resolved. [DAL-8243]
9. An intermittent issue where SureLink could trigger a recovery action for an IPv6 interface even if no IPv6 tests were configured has been resolved. [DAL-8248]
10. An issue with SureLink custom tests has been resolved. [DAL-8414]
11. A rare issue on the EX15 and EX15W where the modem could get into an unrecoverable state unless the device or modem was power cycled has been resolved. [DAL-8123]
12. An issue with LDAP authentication not working when LDAP is the only configured authentication method has been resolved. [DAL-8559]
13. An issue where local non-admin user passwords were not migrated after enabling Primary Responder mode has been resolved. [DAL-8740]
14. An issue where a disabled interface would show received/sent values of N/A in the Web UI Dashboard has been resolved. [DAL-8427]
15. An issue that prevented users from manually registering some Digi router types with Digi Remote Manager via the Web UI has been resolved. [DAL-8493]
16. An issue where the system uptime metric was reporting an incorrect value to Digi Remote Manager has been resolved. [DAL-8494]
17. An intermittent issue with migrating IPsec SureLink setting from devices running 22.11.x.x or earlier has been resolved. [DAL-8415]
18. An issue where SureLink was not reverting the routing metrics when failing back on an interface has been resolved. [DAL-8887]

19. An issue where the CLI and Web UI would not show the correct networking details when WAN Bonding was enabled has been resolved. [DAL-8866]
20. An issue with the show wan-bonding CLI command has been resolved. [DAL-8899]
21. An issue that prevent devices from connecting to Digi Remote Manager over a WAN Bonding interface has been resolved. [DAL-8882]

VERSION 23.9.20.63 (October 11, 2023)

This is a **recommended** release

Part Number	Firmware	sha512sum	md5sum
AW24-Gxxx	AnywhereUSB24-23.9.20.63.bin	8613c3b145260a79d3c8323dc0e943ffa7ee8d321774d748a521caa6ca5ddddd05f39f1b85b5d0667f1692a9698838fb3dd71d4a8e6ba0f294d8b49b2a83334b0	ba7d517cd01d7ee646b157ef4c27f61d
AW24-Wxxx	AnywhereUSB24W-23.9.20.63.bin	ed2bf322407b7aaa31d713bfe0032d5feb5c28329119a67db9bf0fca18532ce360734ec8dcfb1d59bfbbae2e0a2613a10b1acda3d266d503307dd7f36bd33a46	d2950cababe7c51c1d8044c7bed72329
AW02-Gxxx	AnywhereUSB2i-23.9.20.63.bin	63ff6cc498a5ce96ea811166d1388d6bd6ba5e4fe0e8e0f8226fc8abb7d1465984aab71d093d1226cde44ab888c3619e06d486dd7c66cce40db6edd158c45913	15df221cbb0e9fae09e1c15453a823c9
AW08-Gxxx	AnywhereUSB8-23.9.20.63.bin	eb4026b13f1a73a333faec3d61e2a73268876733a8f3ade1ae60558c580ebb4a64075b379b16a4202e8e8a0768fc3c954a65bfd1134bf1b9347f530e7c02c4c8	8d0b8d9aaf49381cadf7c4d94d8e2291
AW08-Wxxx	AnywhereUSB8W-23.9.20.63.bin	f6cf1b42487e527b944fe6c253533a17fd0543bd9c6aea128178809222e92c7f64a19cd79261d29f0acacf431b042ab2402301dacbd503dfc9a516888a91e1d3	013a4081e52a96678b4a35e53a6a2e0f

ANYWHEREUSB SPECIFIC CHANGES

1. Updated awusbd to fix issue where the service could crash under specific high-USB load scenarios [AWG3-3088/AWG3-3106]

FEATURES

1. Added **Status** → **Premium Features** page to the web UI for locally viewing and managing subscription licenses available from Digi Remote Manager [DAL-6636]
2. Added a link to the **Dashboard** of the local web UI to register and add the device to Digi Remote Manager [DAL-6787]
3. Updated the layout of the **Dashboard** page of the web UI to combine the network interface and cellular modem details into a single **Network Activity** panel [DAL-7361]
4. Added MACsec (802.1ae) support and configuration options under **VPN** → **MACsec** [DAL-6825]
5. Improved support for integration with HotspotSystems [DAL-7722]
 1. PSD2 SessGarden
 2. Login/Logout URL
 3. Configurable remote webserver FQDN
6. Added new **System** → **Primary Responder mode** setting to lock down the device to comply with AT&T FirstNet and Verizon Response Verify security options (disabled by default) [DAL-7849]

7. Added new **Services → DNS → Domain allowlist** configuration settings to control what domains are accessible through the Digi device (default is to allow all domains) [DAL-6741]

ENHANCEMENTS

1. Added new **Services → DNS → Fallback server setting** to control what DNS server is used as the fallback in the event that no configured or DHCP-obtained DNS servers are available [DAL-7439]
2. Removed mention of DHCP set in **System → Containers → Address** help text [DAL-6453]
3. Add nrbroadband APN to the fallback list for AT&T SIMs [DAL-8038]
4. Add NFOD-INET-APN01.com.attz APN to fallback list for AT&T SIMs [DAL-8337]
5. Add fbb.home APN to fallback list for T-Mobile SIMs [DAL-8105]
6. Add iot.tmowholesale APN to fallback list for T-Mobile SIMs [DAL-8026]
7. Updated PLMN and ICCID prefix list for T-Mobile SIMs [DAL-8105]
8. Added a new DHCP option to **Network → Interface → WWAN → Type** configuration setting to support advertising the device's hostname over a cellular network [DAL-7641]
9. Added new **Network → Interface → IPv4 → Force link** option to keep the IP network interface up even when the physical Ethernet link for that interface is down (disabled by default) [DAL-8066]
10. Added symlinks in / root directory for file system directories accessible remotely through Digi Remote Manager [DAL-7646]
11. Add serial number to SNMP MIB [DAL-7720]
12. Added new configuration settings under **Services → SNMP** to provide a dynamic set of properties and values to add as OIDs to the SNMP query response
13. Added new **PDP context index** setting when configuring an APN to control what PDP context the APN gets written to within the SIM [DAL-6573]
14. Added **network.modem.modem.dhcp_relay** debug setting to enable DHCP relay support within the cellular modem (disabled by default) [DAL-7312]
15. Updated the input voltage and system/CPU temperature metrics to limit the measurement to one decimal point of accuracy [DAL-7958]
16. Updated the Containers status page in the web UI to validate the name of the container file being uploaded [DAL-7617]
17. Added help text to the pop-up modem when performing modem firmware updates on the **Status → Modems** page in the web UI [DAL-8174]
18. Update **Status → Serial** web UI page to show Log button in **modem emulator** mode
19. Updated the **System → Firmware** page in the web UI and the pop-up notification in the CLI/webUI to include the build date of the firmware [DAL-8022]
20. Updated the setup of serial ports configured with remote TCP listeners to utilize the SSL version specified in the **Services → Web administration → Minimum TLS version** configuration setting (Default TLS v1.2) [DAL-7915]
21. Added new **System → Containers → Working directory** configuration setting to specify the path within the container to use as the initial working directory when starting the container [DAL-8007]
22. Renamed the title and updated the help text of the **System → Containers → Clone DAL** configuration setting, which is now titled **Clone host system libraries** [DAL-7989]
23. Improved the log messages while the cellular modem is connecting to better reflect the Surelink state and why Surelink tests were skipped [DAL-8085]
24. Add WAN Bonding status and details to support report information [DAL-8371]
25. Updated the help text for TACACS+ under **Authentication** config settings to note that the # character cannot be used in the TACACS secret key [DAL-8273]

26. Add `#swpkgv` AT command to support report for additional firmware details from Telit modems

BUG FIXES

All bugs listed affect firmware versions 23.6.1.118 and older unless specified.

1. Fixed issue preventing modem firmware OTA updates from completing when initiated via Digi Remote Manager and the update was done over the device's cellular connection [DAL-8333]
2. Fixed race condition where the NTP server failed to start if an active NTP sync was in progress [DAL-8122]
3. Fixed issue where Surelink fail_count metric was not reported to Digi Remote Manager when Surelink tests were passing [DAL-7975]
4. Fixed rare issue where the cellular carrier reported to DigiRM would be "0" instead of the carrier name [DAL-7924]
5. Fixed occasional issue where the device would not update Digi Remote Manager with the new firmware revision after a modem firmware update was initiated from Digi Remote Manager [DAL-7983]
6. Fixed issue where Surelink metrics weren't reported properly to Digi Remote Manager for bridge interfaces on the device [DAL-7990]
7. Fixed issue where the cellular APN metric was not being reported to Digi Remote Manager (affects firmware versions 23.3.x through 23.6.1.105) [DAL-8055]
8. Removed meaningless warning in system logs stating that there was an invalid key for the anywhereusb service (affects firmware versions 23.6.1.x) [DAL-8000]
9. Fixed issue where the Digi device could connect with the configured APN list out of order if it had previously connected with one of the configured APNs [DAL-8335]
10. *1003-CM07 CORE modem*: Fixed issue preventing failover to secondary SIM slot with EM7411 modems (affects firmware versions 23.6.1.x) [DAL-8191]
11. *1003-CM07 CORE modem*: Fixed rare issue where the EM7411 and EM7511 cellular modems could initialize in the wrong mode and prevent cellular connectivity [DAL-7923]
12. Fixed issue preventing cellular connections with the secondary SIM slot if multiple network interfaces were configured per-SIM slot (affects firmware versions 23.3.x through 23.6.1.x) [DAL-8115]
13. Fixed missing temperature info in the Admin CLI, web UI, and in the metrics reported to Digi Remote Manager [DAL-8132]
14. Fixed issue preventing certain SFP+ modules from being utilized (affects firmware versions 23.3.x through 23.6.x) [DAL-8186]
15. Fixed issue where the wrong destination IP and MAC address was used for Surelink ping tests on GRE tunnels [DAL-8385]
16. Fixed issue where cellular utilization reports in Digi Remote Manager would be skewed due to the device reporting incorrect Rx/Tx data usage metrics to Digi Remote Manager (affects firmware versions 23.6.1.x) [DAL-8380]
17. Fixed issue where WPA2 mixedmode Wi-Fi client-mode connections would revert to WPA-only and prevent connection to WPA2 APs [DAL-8443]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of 9.8 Critical

1. Update all product firmwares to use OpenSSL version 3.0.8, including configuration setting to enable FIPS 140-2 compliance
2. Updated OpenSSH to version 9.3p2 [DAL-8097]

1. CVE-2023-38408 (9.8 Critical)

VERSION 23.6.1.105 (July 16, 2023)

This is a **mandatory** release

Part Number	Firmware	sha512sum	md5sum
AW24-Gxxx	AnywhereUSB24-23.6.1.105.bin	cfcdb8725ea5ac637b23a7097a0fd941f4c20aae9078a86c440fef206867563b99a7684a04513504b305fcbcbec9896e88717acc62a06f72480ba6abeb0aa142	b6ff9cc82fafb99a62cdf71b6c2e9127
AW24-Wxxx	AnywhereUSB24W-23.6.1.105.bin	537a76c809efdf939ee7a13263b6118541b99a955e57b6d81164e591db63f2351eea50d8bcac4294f8f3220653f18594b2e803b5476001694c487eb3bfb6eb50	1e8bd2080c2b137abe490ea660f46eed
AW02-Gxxx	AnywhereUSB2i-23.6.1.105.bin	bfcf8ff17270274c0df5d493b8b8ef292d5139b0e8e66340a44238fda1f3d604041d08b843fb4b0dd2e9fb3cf26f5d2c7c4acb85f726e85228d0772883867ec3	9e63373c89722c01765a6c64ce33b404
AW08-Gxxx	AnywhereUSB8-23.6.1.105.bin	382d8f63548dd6e17497c537b72c58ef4125d280025c3885157a694eb508a86e83fad9632d15340656497b26147832a17040d3b42e339279948e085cd8393806	05c84ac23d6dd45e370976c90561a5d5
AW08-Wxxx	AnywhereUSB8W-23.6.1.105.bin	e6966b31d4251f36844e9671a20a423cb720486bdb5548a437296ece83a5657327fa3168876f2986126c3a1aeb3a30010ba27fc7cb3a23ee00ecf798a8c5ee12	15d85ef30f81ccc20a32db6c3fce3172

ANYWHEREUSB SPECIFIC CHANGES

1. Fixed issue **system usbtrace start** CLI command from starting [DAL-7947]
2. Fixed issue preventing AnywhereUSB plus devices from initializing and using USB devices with 2 configurations

FEATURES

1. Added new **Modem emulator** mode to serial ports to allow them to act as a dial-up modem emulator for handling incoming AT dial-ins [DAL-6669]
2. Added ability to receive a remote command from Digi Remote Manager to perform a SIM survey, which will attempt connections to each SIM inserted into the Digi device, then switch back to its previously-used setup before the SIM survey and report each of the SIMs' connection details to Digi Remote Manager (signal strength, APN used, connection status, cellular tower info, etc)
3. New unsolicited query_state RCI responses in DigiRM for reporting system temperature and modem firmware versions [DAL-6550]

ENHANCEMENTS

1. Add **System → Advanced Watchdog** configuration options to monitor memory usage, critical services and automatically reboot if those services fail
2. Automatically generate a support report in /opt/digi-support-watchdog-mem-full.bin before a device reboots due to a watchdog memory-full condition [DAL-7948]
3. Added option for receiving modem_firmware_update remote command from Digi Remote Manager with a specific modem firmware version to update to [DAL-7656]
4. Added the following details to the metrics sent to Digi Remote Manager about the cellular

modems inside the Digi device [DAL-7800]

1. Add a unique ID tag to the response messages sent to DigiRM after a modem firmware update was initiated
2. Include modem name and updated version in the modem firmware metric
3. Ensures that modem firmware versions listed for the device are updated in DigiRM after a modem firmware update completes
5. Report the modem IMEI to Digi Remote Manager even when no SIM is installed [DAL-6778]
6. Added the following new values to the datastream metrics and RCI query_state responses reported to Digi Remote Manager [DAL-6868, DAL-6549, DAL-6655, DAL-6576]
 1. cellular/x/sim/y/registration - roaming/registration status of the modem
 2. metrics/eth/1/surelink/rtt - ICMP ping round-trip time for the Surelink ping test
 3. metrics/eth/1/surelink/fail_count - Count of failed Surelink tests, which gets reset if the tests start passing
 4. vpn/ipsec/x/disconnects - number of disconnects the device has had on an IPsec tunnel
 5. eth/x/link - up/down physical link status of the Ethernet port
 6. metrics/wifi/x/ - rx/tx/packet-count statistics for any configured Wi-Fi client-mode connections
 7. metrics/wifi-ap/ - rx/tx/packet-count statistics for any configured Wi-Fi access points
 8. sys/chassis/voltage - input power supply voltage
 9. sys/chassis/temp - temperature of the device
7. Immediately upload all health metrics on the first time it establishes a connection to Digi Remote Manager [DAL-7559, DAL-7504]
8. Display the active interface used to connect to Digi Remote Manager in the Dashboard page of the web UI and the show cloud Admin CLI output [DAL-6446]
9. Updated the minimum-allowed location update and cellular modem update interval to 1-second [DAL-7440]
10. Added new Location source option to directly poll the cellular modem's GPS port [DAL-7682]
11. Added new **VPN → IP tunnels → Enable open routing** configuration setting to allows packets destined for an address which is not explicitly in our routing table to exit the iptunnel [DAL-7076]
12. Added new **Network → Advanced → TCP retries2** configuration setting to control the number of times an unacknowledged TCP data packet will be retransmitted before the connection is considered lost (default 15 retries) [CEZ-570]
13. Update the help text descriptions for all serial port modes for additional clarity
14. Updated the SSH server enabled for serial ports to reference any configured custom SSH options in **Services → SSH → Custom configuration** [DAL-7863]
15. Added a new configuration setting under the options for a serial port set in PPP dial-in mode to control whether a default route gets added for the PPP interface (default: disabled) [DAL-7798]
16. Improved wording in the error message when a TACACS server cannot authorize the full CLI command due to RFC length constraints [DAL-7852]
17. Create a system log if WAN Bonding is enabled but unsubscribed [DAL-7882]
18. Removed the **Network → SD-WAN configuration** configuration section [DAL-7881]

BUG FIXES

1. Fixed errant IPv6 packets from being transmitted over a PPP dial-in serial connection [DAL-7799]
2. Fixed issue where WI-Fi hotspots would not startup correctly if they weren't linked to a

- network bridge [DAL-7623]
3. Fixed issue with improper LWM2M setting on LTE Cat-M modems preventing registration issues with AT&T and Verizon [DAL-7383]
 4. Log message about intelliFlow being unsubscribed only if intelliFlow is enabled
 5. Fixed configuration migration of IPsec Surelink settings from 23.3.x firmware to not add an **update_routing_table** action, as that action is not applicable to IPsec tunnels [DAL-7892]
 6. Fixed incorrect status reported for Surelink status of IPsec and OpenVPN tunnels in the CLI and web UI [DAL-7893]
 7. Fixed issue in Surelink migration from 22.11 and older firmware where IPsec and OpenVPN tunnels would not have their Surelink settings migrated over [DAL-7747]
 8. Fixed issue in Surelink migration from 22.11 and older firmware where success_condition=all wasn't always properly migrated [DAL-7803]
 9. Fixed issue in Surelink migration from 22.11 and older firmware where ping tests switched their default ping size from 20 to 1 byte, which can cause issues on some cellular networks [DAL-7769]
 10. Fixed incorrect Surelink status reporting when Surelink was disabled on a network interface [DAL-7552]
 11. Fixed logic of default DNS test so skipped tests are considered passing tests [DAL-7814]
 12. Fixed rare issue where the device would report its MAC address as all zeroes when it initially connected to Digi Remote Manager [DAL-1609]
 13. Fixed issue with utilizing BGP capability 70 to DMVPN hubs [DAL-7740]
 14. Fixed bug where SNMP wouldn't provide updated settings if someone configured a new hostname for the device [DAL-7442]
 15. Fixed bug where Intelliflow data would reset each time a network interface update happened on the Digi device [DAL-7579]
 16. Fixed but preventing users from configuring network subnets in OSPF routes [DAL-7603]
 17. Fixed issue where multiple SSIDs were not being scanned when DFS client support was enabled [DAL-7608]
 18. Fixed issue preventing EG25-G & EC25-AF modems from connecting with certain SIMs with APNs that required username/password authentication [DAL-7644]
 19. Fixed missing ICCID and modem firmware revision was not reported by the device [DAL-7757]
 20. Fixed rare issue where LM940 would power off after a modem firmware update [DAL-7719]
 21. Fixed intermittent issue where LM940 modem would disappear after switching SIM slots [DAL-7638]
 22. Fixed issue preventing devices from performing OTA firmware updates through the **System** → **Firmware update** page in the web UI or the system firmware ota CLI command [DAL-7539]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of 9.8 Critical

1. Update to Linux kernel version 6.3 [DAL-7606]
2. Updated busybox to version 1.36.1 [DAL-7819]
3. Update to OpenSSL version 1.1.1u [DAL-7818]
4. Update libcurl to version 8.1.2 [DAL-7817]
5. Update OpenSSH to version 9.3p1 [DAL-7816]
6. Update libgmp to version 6.2.1 [DAL-7820]
7. Update OpenVPN to version 2.6.4 [DAL-7822]

8. Update strongswan to version 5.9.10 [DAL-7823]
9. Update dnsmasq to version 2.89 [DAL-7533]
10. Update netifd/ubus/UCI/libublox to OpenWRT 19.07 build [DAL-6766]

VERSION 23.3.31.129 (May 4, 2023)

This is a **mandatory** release

Part Number	Firmware	sha512sum	md5sum
AW24-Gxxx	AnywhereUSB24-23.3.31.129.bin	a3f327529a17e233118c5ea6b05de0dcb9e26049c8ddad115c93f1a0fd321a0ac2606b9c54a539204dbbd1dbe8bf522c09d2eef0c54318405a94de3b7cd0612f	b227c352dfc69b701f7f6e7d9d41de5a
AW24-Wxxx	AnywhereUSB24W-23.3.31.129.bin	07a3f7bc66a7c816b34f8b3ffdf094b3379186089b25f254171bf2c6189b0e353022998751f77bdfce012dc8dfca41f3e1f2435c28fbc9830a42502afb364bbe	b2b400e430228c34c97c223e13e66c96
AW02-Gxxx	AnywhereUSB2i-23.3.31.129.bin	1a50ab89d8b4610698a11d2ab1a8a8a563e9e037589d1aac11155a3b6a0355180a001a2ad05c9aaf3b91d7377935844833a997e73504bc08deae9ab3bf1866df	3905b28c648b776ab7f54790411c44e2
AW08-Gxxx	AnywhereUSB8-23.3.31.129.bin	32358ac7ee7c61f4b7ed7ab630e66cc42e0d5e8a20c4757c93ff37bdc94ef79b803087fde9f969b9073df29df90ac90d5a582c716ccf61fcdc2a0adf25b6d393	c7ab7c6ea231e39714d8025e7c833c2e
AW08-Wxxx	AnywhereUSB8W-23.3.31.129.bin	b0fbc082a871f9f2d21bb6e63e6a085eae9d3420d91d252441dd6b865446c7a575b507a3bb749eab5723aeee4f4edcdf9616b194993d7a1ad4acd83b25cc17a8	66b04ef4bb2a2099f20a0401720c7dde

ANYWHEREUSB SPECIFIC CHANGES

1. Fixed issue where the anywhereusb service would not startup after a reboot when a client connects for the first time to the USB port [AWG3-3046]
2. Fix issue where some USB ports could stop responding. [AWG3-2976]

FEATURES

1. Redesigned Surelink configuration settings [DAL-6646]
 1. Surelink configuration settings are now listed in a single section under each network interface, as opposed to a separate section for IPv4 vs IPv6. The layout of the connectivity tests and recovery actions to perform have been redesigned to provide a more streamlined setup. Any configured tests and recovery actions are performed in the order they are configured, along with a new capability for integrating custom scripts as a test or recovery action. See the [Surelink section](#) of the Digi device's user guide for additional details.
 2. **Important note:** when upgrading a device with non-default Surelink settings from 22.11.48.x or older firmware to 23.3.31.129 or newer, there are some instances where those Surelink settings will not migrate and the device will revert back to default Surelink settings. Digi strongly recommends that you test the new firmware release in a controlled environment with your application before you update production devices. Pay particular attention to your Surelink configuration settings before and after the firmware update, and review any changes before rolling out the 23.3.31.129 release to mission critical devices

3. **Known migration issues with 22.11.48.x and older firmware:**

1. If an IPv4 Surelink specifies one test but the IPv6 specifies all tests, then all tests will be selected and Surelink may not behave as expected. The same applies for the reverse - IPv4 specifies all tests and IPv6 specifies one test.
 2. The previous version didn't correctly go out the correct interface in every condition. It was possible to pass the ping test without the interface even being up. This is now fixed in 23.3.31.129 firmware and newer so tests are forced out the correct interfaces by marking the packet.
 3. If migrating from a very old version (firmware versions 20.2.x and older), the config cannot be migrated as it is incompatible. In this scenario, we use the default Surelink configuration for all interfaces
 4. If there are conflicting Surelink action or test settings for IPv4 and IPv6 (eg intervals etc), the device will use the IPv4 in preference when migrating the configuration as part of the firmware
2. DMVPN phase 1 spoke support with NHRP or mGRE, including compatibility with Cisco DMVPN hubs [DAL-6709]
 3. Added ability to utilize the cellular modem as a time sync source under **System → Time** [DAL-6693]

ENHANCEMENTS

1. ModemManager updated to version 1.20.6 [DAL-6406], which includes:
 1. improved 5G SA-mode and NSA-mode performance
 2. RSRP/RSRQ/SINR statistics for 5G SA-mode connections
 3. Native multiplexing for dual-APN setups
2. Added **show surelink state** Admin CLI command to display the overall pass/fail status of the enabled Surelink tests [DAL-7070]
3. Added options under **Network → SD-WAN → WAN bonding** to configure the mode for each tunneled interface and the overall mode of the WAN bonding tunnel [DAL-7394]
4. Updated WAN bonding saneclient to version 20221103 for 5G and 1Gbps performance [DAL-7005]
5. Added new **show wan-bonding** Admin CLI command to display status of WAN Bonding tunnel [DAL-7395]
6. Added new **Status → WAN Bonding** page in the web UI to display status of the WAN Bonding tunnel [DAL-7395]
7. Added distance between the WAN bonding and Ethernet bonding setting sections in the configuration accordion
8. Added configuration settings under **System → Containers** to allow the container to be auto-started on boot with optional parameters and restart if the container stops [DAL-7021]
9. Added configuration settings under **System → Containers** to setup shared directories between the host filesystem and the container [DAL-7021]
10. Support for US cellular consumer SIMs without requiring the user to first configure the APN [DAL-7248]
11. Disable mDNS by default on EX/IX/TX products for improved cellular performance [DAL-7354]
12. Added GlobalGIG APNs to fallback APN list [DAL-6886]
13. Added new **AT&T LWM2M support** setting for enabling/disabling LWM2M on the modem (enabled by default) [DAL-7009]
14. Added IPv6 support for MQTT broker, location servers, and mDNS service [DAL-7111]

15. Include the system hostname (if configured) on the Dashboard page in the local web UI [DAL-7428]
16. Added support for SHA2 ciphers for IKEv2 IPsec tunnels [DAL-7038]

BUG FIXES

1. Fixed issue preventing users from locking a device to use a blank APN [DAL-7248]
2. Pre-shared keys for configured Wi-Fi SSIDs are now obfuscated in Digi Remote Manager [DAL-7107]
3. Fixed issue where configuration options for selecting the Wi-Fi channel appeared as “None” in Digi Remote Manager [DAL-7482]
4. Fixed issue preventing device from falling back to its local system time when running as a NTP server [DAL-7233]
5. Fixed issue preventing SIM failover when the device was configured with separate network interfaces set to match by carrier instead of SIM slot [DAL-6910]
6. Removed 3-second stop/start delay when making configuration updates to the MQTT broker settings [DAL-7104]
7. Fixed issue where **tail** CLI command required a filter option in order to utilize the match option [DAL-7038]
8. Fixed issue preventing WAN bonding interface from appearing in the **show route** CLI output [DAL-6829]
9. Fixed issue where initial Surelink test would fail if the cellular modem was configured to be in passthrough mode [DAL-6224]
10. Fixed possible routing issue between GRE/IPsec with Cisco peer GRE/IPsec using VTI configuration [DAL-6722]
11. Fixed issue where serial logging enabled on Realport serial ports never closes the logging session [DAL-6748]
12. Fixed issue preventing SMTP notifications from using TLS encryption [DAL-7079]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of **9.8 Critical**

1. Update to Linux kernel 6.1 [DAL-7179]
2. Update OpenSSL to version 3.0.8 and 1.1.1t [DAL-7261]
3. Update netifd to version 18.06 [DAL-6280]
4. Update libexpat to version 2.5.0 [DAL-7082]

VERSION 22.11.48.10 (November 24, 2022)

This is a **mandatory** release

Firmware	sha512sum	md5sum
AnywhereUSB24-22.11.48.10.bin	011db731c3e7beaed02dd4fbd8ea7d344b29415268d829d6cd5b7efe9162078edd86deccafc7155ca3dba884beea1b690554210f173828a1ada0a55914549c3a	3d64230d1f8e87c7969bec5c769749e9
AnywhereUSB24W-22.11.48.10.bin	0ec673df9a1af6c567971c2dba3e6deaa2093e54f34b32e65641de73781903bd11e2b883cdf22a57a62e8db6308a6a2f323f830524bb51994cdf1a53015c778	65f62aa5c2b2264f7d09f265c655d5a4
AnywhereUSB2i-22.11.48.10.bin	ddf50ba22aabf8424d3e9c9c961e146f1d49097e581f8a613b710e9a805b41207400fe11a2fa573596fabd1447739a2f50b2532d810834285397a7e62ade9707	3591f599cdb0c5c5a32222f3e3f7984d

AnywhereUSB8-22.11.48.10.bin	8ba5eb287f8d652e6d2fe3d20ca690c8c977134e7a10bf997b5e3e89e80fedf6cb5c662008f9c6473867af8a58a2cfb3de59a14cf97b5084486dd83294217c7d	1e0e249f8b2e6bba2f527f9906d610de
AnywhereUSB8W-22.11.48.10.bin	0280a2cf2a0e45b499102f9200d853be6708da868b3ff8ffc560bd53b5ac8ea03dbf772e355165b3d2aae5d12d349a2c740a9516d3f32f2e89be91aa8825bc76	d5b100875b78ba77d8a0da7497f73d36

ANYWHEREUSB SPECIFIC CHANGES

1. Fixed issue where AnywhereUSB 2 Plus devices running 20.5 or older firmware would be reset to default settings if updated to newer firmware [DAL-6649]
2. Fixed intermittent issue where the USB debugging wizard could crash the device if tracking too many USB connections at once [DAL-6999]
3. Fixed intermittent issue where the awusb manager would lose access to certain USB ports until the AnywhereUSB 8/24 Plus device was rebooted [AWG3-2976 & AWG3-2926]

NEW FEATURES

1. Updated the IntelliFlow feature to integrate with Digi Remote Manager for aggregated insights and analytics [DAL-6656]
2. Add options under **Network → Routes → Routing services** for configuring Next-hop routing protocol (NHRP) advertisements [DAL-6711]
3. Added advanced watchdog to monitor critical services and automatically reboot if those services fail. The advanced watchdog also monitors system memory usage and will automatically log an error and reboot the device when memory usage exceeds 95%. The advanced watchdog settings can be configured and the **System → Advanced watchdog** section of the device's configuration [DAL-6094]

ENHANCEMENTS

1. Add option under **VPN → IP Tunnels → Mode** for supporting mGRE tunnels [DAL-6709]
2. Added option under Network → Advanced settings to allow ICMP redirect messages (disabled by default) [DAL-6013]
3. Disable automatic modem/device firmware update options if using DigiRM [DAL-5738]
4. Added new **Signal strength query interval** setting under the **Network → Modems** configuration options to control how often the cellular modem is polled for signal strength and other network status updates (default is once every 5 seconds) [DAL-6272]
5. Display the LTE Cat-M or NB-IoT network type in the Admin CLI, local web UI, and Digi Remote Manager metrics for devices with ME910c1-WW modems [DAL-6155]
6. New **tail** and **grep** Admin CLI commands
7. Send container datapoints to DigiRM with the configured container name instead of container index number [DAL-6551]
8. Update wording of help text for the **Authentication → Methods** options in the device configuration settings to provide clarification on the mode of operation between authoritative versus non-authoritative options [DAL-6928]
9. Add modem scan timeout option to **Scan** window on the **Status → Modems** page in the web UI [DAL-6938]
10. Update error message in the web UI when restoring a configuration backup if the web connection is lost before a response is received [DAL-6553]
11. Added new **Data logging** options under **Serial** configuration settings to have any data sent/received on the serial port logged to the system logs in addition to whatever mode the serial port is in [DAL-6719]
 1. Remove options in the local web UI and Admin CLI for manually

starting/stopping/clearing serial logs. These actions are now controlled under the **Data logging** configuration settings

BUG FIXES

1. Fixed occasional issue where containers could not start due to a permissions issue [DAL-7041]
2. Fixed intermittent issue preventing configuration restores from the Admin CLI due to the output of the **show config cli_format** command presenting configuration settings in the wrong order [DAL-6435]
3. Fixed issue in digidevice.sms python library where it couldn't process MMS messages [DAL-6952]
4. fix output of iperf speedtests in the Admin CLI [DAL-7001]
5. Disable GPS reading on ME910c1-WW modems to prevent CPU utilization spike from ModemManager [DAL-6575]
6. Fixed intermittent issue with SIM failover on devices with Telit LM940 modems [DAL-6569]
7. Fixed intermittent issue preventing modem firmware updates if no SIM card was inserted into the active SIM slot [DAL-6309]
8. Fixed issue resulting in slow upload speeds for clients connected to a Wi-Fi hotspot [DAL-6674]
9. Fixed intermittent issue in IPsec strict routing mode where a default route change could result in packets not going through the IPsec tunnel [DAL-6518]
10. Fixed intermittent issue where a device configured as a L2TP LAC would sometimes drop its tunnel and not automatically reconnect [DAL-5415]
11. Fixed intermittent issue where a device configured as a L2TP server would sometimes drop packets from L2TP client tunnels [DAL-6696]
12. Fixed issue preventing L2TP tunnels from running if they were configured with a name longer than 12 characters [DAL-6718]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of **9.8 Critical**

1. update Linux kernel to version 5.19 [DAL-6558]
2. update shellinabox to version 2.21 [DAL-5430]
3. update systemd to version 245 [DAL-5421]
4. Prevent escalated filesystem access through DigiRM [DAL-6784]
5. update OpenSSL to version 1.1.1s [DAL-6991]
6. update jquery to version 3.6.1 and jquery-ui to version 1.13.2 [DAL-5686]
7. update default OpenVPN server cipher from AES-256-CBC to AES-256-GCM [DAL-5737]

VERSION 22.8.33.50 (August 26, 2022)

This is a **mandatory** release

Firmware	sha512sum	md5sum
AnywhereUSB2i-22.8.33.50.bin	dcd875b61aaebff494e22e1bb1a71adf8fbd4eaa21d f5ab1d4f06e05cad44a4dabe22a439c53a774ec04766 17c7a953b3fcfa573beea09c116c379d163eda5	6779d19d90d0b135b7ef12adf952c8dd
AnywhereUSB8-22.8.33.50.bin	8a0b504dc8faf77fee58623b239aa2f79abe7f0f1d6c9f 2916b23932cfa796c5567ff2b1bff589aabe55b19f0fda	136bbc182ae00b58bc1444f838e7bf08

	3b35544a28589ab8f696b3a814d1a1bc926b	
AnywhereUSB8W-22.8.33.50.bin	980d66652c66ff9870b935dee527f4174c1721144603c699e38a0b7abef76fc416c6af05d4b5b8b67fc4290a970327e036928064fe63a45d13bc6c8516a49953	abedb68a4b076b29455ba054690f64b2
AnywhereUSB24-22.8.33.50.bin	f40baa0b8094f5f4b1774740c01cab527eada25d8eaa2f3a75628cb5115c1f4bcd507a069ab3081e916f516d1a18fa3a1ae8a5497dfc34d71b09c56ed4f86e71	aab35da7cf96a2888cdc3a1331c1d6eb
AnywhereUSB24W-22.8.33.50.bin	33e1638b9ec8abe1acaafb9050932ed97634090d44820dc3551e31ba692163cf64013957ba755f6b95a16da8f2f9627f26aa01ee371fdbd5269191b4a52439a1	8cbfb34b104fee09146f2f36195f21d5

ANYWHEREUSB SPECIFIC CHANGES

1. Added new option to the **Status → AnywhereUSB** page in the web UI to launch a Wizard to collect USB debug logs from the device [AWG3-2889]
2. Automatically power cycle USB ports linked to an AnywhereUSB group when a user disconnects from that group [AWG3-2780]

FEATURES

1. Added configuration options for running a PPPoE server in IP passthrough mode [DALP-1045]

ENHANCEMENTS

1. Update firmware OTA downloads to utilize the Digi Remote Manager firmware repository (firmware.devicecloud.com) [DALP-606]
2. Always display **Central management → Firmware server** configuration setting regardless of which central management service is selected [DAL-5719]
3. Always display **Central management → Speedtest server** configuration setting regardless of which central management service is selected [DAL-6527]
4. New **modem firmware ota download** Admin CLI command for downloading cellular modem firmware from the Digi firmware repository [DAL-6541]
5. Add ability to specify DFS channels under **Network → Wi-Fi → Client mode connections** for background scanning when **DFS client support** is enabled [DALP-1004]
6. Add cellular carrier name and **PLMN ID to Status → Modems** page in the web UI [DAL-6554]
7. Mark Containers as a premium feature enabled via Digi Remote Manager [DALP-1038]
8. Support the ability to start/stop containers via RCI commands from Digi Remote Manager [DAL-6468]
9. Added new metrics for sending container status, name, CPU load, and disk usage as datapoints to DigiRM [DAL-6404]
10. New **show eth** Admin CLI command to show the link status of each Ethernet port [DAL-6126]
11. New **poweroff** CLI command to perform a graceful shutdown of the device without automatically rebooting [DALP-982]
12. Added new **Strict routing** setting to IPsec tunnels that, if enabled, will only route packets through the tunnel if both the source IP and destination IP match the IPsec tunnel's policies instead of NAT-ing traffic that only matches the remote network policy [DAL-5317]
13. Added new MS-CHAPv2 option under **L2TP → L2TP network servers → Authentication method** to support clients that require MS-CHAPv2 for authentication to a L2TP/IPsec server [DAL-6327]
14. Store kernel crashes and debug logs across reboots and automatically add them to the system logs in /var/log/ [DAL-6496]

15. Include AT#FWSWITCH output in support reports [DAL-6580]
16. Added **network.modem.modem.gea1_cipher** debug config setting that can be can enable GEA1 cipher and speed up initial connectivity and SIM failover on Quectel modems [DAL-5258]
17. Automatically refresh the **System → Firmware Update** page in the web UI after a user clicks the Duplicate Firmware button [DAL-4750]

BUG FIXES

All bug fixes listed below affect firmware versions 22.5.50.62 or older unless specified otherwise

1. Added new **Network → Routes → Routing services → BGP → Networks** section for defining specific IP networks to advertise to BGP peers [DAL-6368]
2. Fixed issue where manual carrier selection through the web UI, configuration settings, or Admin CLI would fail to connect if the SIM required a APN username/password with CHAP authentication [DAL-6552]
3. Fixed L2TP setups so it only adds a default route for the tunnel if the defaultroute custom PPP setting is specified [DAL-6328]
4. Add **timeout** option to **modem scan** Admin CLI command to allow users to specify a longer scan period for SIMs that can roam to a larger number of nearby carriers
5. Fixed buffer limitation of 1024 characters when copy/pasting text into the Admin CLI [DAL-6445]
6. Fixed issue where kernel-level system logs were logged with UTC timestamps regardless of the locally-configured timezone [DAL-6408]
7. Fixed issue with sending UCS-2 formatted SMS messages with UTF-16 characters [DAL-6318]
8. Fixed issue preventing the Digi device from connecting to Digi Remote Manager over a HTTP proxy through an IPsec tunnel [DAL-6430]
9. Fixed permission issue with starting containers added via Digi Remote Manager [DAL-5844]
10. Fixed invalid format of SIM ICCID metric sent to Digi Remote Manager [DAL-6394]
11. Fixed issue where Wi-Fi client would not reconnect if the config settings were disabled and then re-enabled [DAL-6592]
12. Fixed issue where the **Reset modem** Surelink option would prevent the **SIM failover** Surelink option from taken affect if both Surelink settings were enabled (affects firmware versions 22.2.x through 22.5.x) [DAL-6343]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of **9.8 Critical**

1. Update OpenSSL to version 3.0.5 and 1.1.1q (CVE 2022-2274, CVE-2022-2068)
2. Update Linux kernel to version 5.18

VERSION 22.5.50.62 (June 14, 2022)

This is a **mandatory** release

Firmware	sha512sum	md5sum
AnywhereUSB2i-22.5.50.62.bin	7f17cc9aec545bca7dd2f6298cb831b9226065d06e87b0ba9df4f32b27b19b812548322f8abc1315b36a268dba45ac37595f281399c6899fc66d8f9f607d2ab8	98894bba9ea24cabeed0712ffd2b2c05
AnywhereUSB8-22.5.50.62.bin	9564b3af45b20474bc5b8e8fcd84d8c868e5cb37a90ed13a16392828abd5b67c9bd65af5903b69fd389202290f1b7e81f874f21d552494a04e1f2ff9f26c2c2	e37ae688cbde1a80cf5f1c3222e13b47

AnywhereUSB8W-22.5.50.62.bin	26f2f53c196e8017f5390706b550f17e1ef535d905733fd356ebcac37d2198e15d19eb9cd7fa8ff5af6db4714f46263f34f77c3fad2fa687bf2149232926308f	ce9d5a541635ad7648dd955c09863a90
AnywhereUSB24-22.5.50.62.bin	7421ba8886fad2b7d4932b16add6764fd0722c1e9c408c61cce52f952900a11710f378db8803959a9691be5a95a585da77003af00b8e14d8cbb346feb0b7cd10	31decd280d73f91782409a7bee68eb8d
AnywhereUSB24W-22.5.50.62.bin	109c74574978e343d241c496cd0c35189e4bb5e50c4041ba8d673d6ae512c8041d4f58e0af46038589fa2a2e868b1a2cb8ebffe5a56554389bdc1c38e89e8010	1cc0a42ff1e60a2b925a9214eca68720

FEATURES

1. New **Network → SCEP Client** settings and underlying functionality to support connecting to additional SCEP servers, including Fortinet FortiAuthenticator, DigiCert, EJBCA, and Windows server [DALP-1007, DALP-1022]
2. New *show scep* Admin CLI command for showing the sync status, expiration dates, and additional details of any configured SCEP clients [DAL-6069]
3. Support for enabling add-on features from Digi Remote Manager [DALP-673]

ENHANCEMENTS

1. Remove time.accns.com from default list of NTP servers unless **Central management → Service** is set to **aView** at the time of updating firmware from version 22.2.9.85 or older [DAL-5543]
2. Added new **system.log.persistent_path** configuration setting to specify where system logs are stored locally, which could be on the device or to an external storage (e.g. USB flash drive, SD card, etc) [DALP-946]
3. New **Services → Location → Destination servers → Behavior when fix is invalid setting** to control the NMEA message content sent when there is no valid fix from any of the configured location sources [DAL-5984]
4. Improved the message shown on the **System → Configuration maintenance** page of the web UI if an error is encountered when restoring from a backup config file [DAL-6141]
5. Include the hostname of the device in the client .ovpn file listed on the **Status → OpenVPN → Servers** page in the web UI [DAL-6157]
6. Filter out non-Internet type APNs from our APN fallback list [DAL-6227]
7. Automatically power cycle the cellular modem in the event that a *modem reset* Surelink action fails [DAL-6268]
8. Enable Surelink *reset_modem* action by default on cellular interfaces and set fail count to 3 [DAL-6275]
9. Add cellular APN and cellular connection duration as datapoints sent to DigiRM [DAL-5902]
10. Ensure modem is in enabled state before attempting to connect [DAL-6163]
11. Omit non-production modem firmware from the OTA query results in the **Status → Modems** page of the web UI [DAL-6301]

BUG FIXES

The below bugs are all present on firmware versions 22.2.9.85 and older unless otherwise specified

1. Fixed issue preventing Telit LE910 family of modems from registering after changing APNs without a reboot [DAL-5971, DAL-6016, DAL-5203]
2. Fixed issue preventing connectivity with fast.t-mobile.com T-Mobile SIMs when used with a Quectel modem. Use PDP context 1 for connections on Quectel modems with T-Mobile SIMs [DAL-6401, DAL-5930]
3. Fixed issue where modem-based Location source would sometimes not report properly due

- to an initialization timing error with the modem [DAL-6163]
4. Fixed issue where an IPsec tunnel fails to re-establish the tunnel if SAs are deleted after phase 1 re-authentication [DAL-4959]
 5. Fixed issue where the connection to Digi Remote Manager would delay up to 15 minutes before refreshing to use the active main Internet connection in the event of a network failover or fallback [DAL-6164]
 6. Fixed issue where **OpenVPN → Advanced options → OpenVPN parameters** text box was limited to 64 characters when synced with Digi Remote Manager. The new limit is now 64,000 characters [DAL-6002]
 7. Fixed issue preventing OpenVPN server from authenticating clients with an external LDAP/TACACS+/RADIUS server [DAL-6159]
 8. Fixed broken **Go to Digi Remote Manager** link in the local web UI [DAL-6088]
 9. Fixed issue preventing LDAP external authentication for SSH and Telnet session [DAL-6098]
 10. Fixed typo in description of *container delete* CLI command [DAL-5956]
 11. Fixed output of *show containers* Admin CLI command to list all containers on the filesystem, not just those linked to configuration settings [DAL-5958]
 12. Fixed issue where the *show location* output in the Admin CLI could include an incorrect timestamp if the configured location server(s) had a non-UTC timezone set
 13. Fixed issue preventing **Network → Interfaces → MAC address allowlist** from implicitly denying access to devices not in the allowlist [DAL-6001]
 14. Fixed **Invalid lookup path for : network.interface** error when running `cfg.get("network.interface")` in the `digidevice.config` python module [DAL-6005]
 15. Fixed issue where TAIP messages would have the incorrect timestamp if the timezones between the device and server were different [DAL-6335]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a CVSS score of **9.8 Critical**

1. Update to OpenSSL 1.1.1o (CVE-2022-0778, CVE-2022-1292) [DAL-6035]
2. Update to linux kernel 5.17 [DAL-6081]
3. Patch for “dirty pipe” vulnerability in Linux kernel (CVE-2022-0847) [DAL-5981]
4. Update gcc to version 11.2 and binutils to version 2.37 (CVE-2019-15847, CWE-331, CVE-2018-12886, CWE-209, CVE-2002-2439, CWE-190) [DAL-5444]
5. Update openvpn to version 2.5.6 (CVE 2022-054) [DAL-6229]

VERSION 22.2.9.85 (March 3, 2022)

This is a **mandatory** release

Firmware	sha512sum	md5sum
AnywhereUSB2i-22.2.9.85.bin	ca0b5b69ccda1dc0a21c01fa24f78724177ea5a98bfe3aefb3bc3681d5d3b48f554d97fd7c6169b4f3c7c39ca3589d03e9662fe136a58c3ed06046fe70688ef3	c20ae091cc48944d5dbf3fec8d220bc1
AnywhereUSB8-22.2.9.85.bin	c1fd9243246d9ce4aaef0855788f80cc1a2c276eac4f3c7df851c9e205f7dc88f2e6a8d8d1a7084856eb82d8025691906bf2dd13d9a0745302cf89a7603c9a4	75c5f3cddac66e92446605fee467bc61
AnywhereUSB8W-22.2.9.85.bin	62edf3e91ea9ef0f102b53abbdc2d54a13656d732fff4d093d11aaf4108ffe3190e1e13e133c003beccb57a4fa6e385663693de853d88f3a8c28a530dc38330	b1a39000f8936f2b7eaf032b16c73dfd
AnywhereUSB24-22.2.9.85.bin	fe8fe98f9bb683f5a67b36b77c8b55d7ee29e54fa172396ef414ff36e83d7992688323c5d6d7f887e7e2a0822d	a5126cbb230eb044aa9377612142dbd1

	829a2bf7e4a7fd85aeb47a21ee4fb008155875	
AnywhereUSB24W-22.2.9.85.bin	d28cde597f61e08d1290b02ac2a88e19d1c044bbcbe7ee1c4d1173cf45b73b37988912d1d8e871a3076cc4b6f90ee46fc7251df8438a1fdcc9800348fb64d736	6935c2095a6f807840f3be18bcb2bbb3

FEATURES

1. Added new option under **System → Time → NTP → Use GNSS module** to enable the device to use its internal GNSS module as a date/time sync source [DAL-5760]

ENHANCEMENTS

1. Update default Digi Remote Manager URL to edp12.devicecloud.com [DALP-972]
 1. In firmware versions 22.2.9.85 and newer, the default central management server changes from **my.devicecloud.com** to **edp12.devicecloud.com**. This change enables more secure connection negotiation and enables support for device certificates. If your device connections are managed by a firewall, or your devices do not have direct access to public DNS servers, you may be required to make firewall changes to open connectivity to edp12.devicecloud.com, or to enable DNS. See <https://www.digi.com/support/knowledge-base/firewall-concerns-for-outbound-edp-connections-to> for more information about device connectivity to Digi Remote manager.
2. Increased web UI upload limit to 512MB [DAL-5694]
3. Added new **Surelink Switch SIM** and **Switch SIM fail count** options to specify how many times the Surelink test must run and fail on a cellular modem before the device switches to the alternate SIM slot [DAL-5717]
4. Support for standard SCEP servers [DALP-821]
 1. Previously the SCEP client only supported syncing with Fortigate SCEP servers. Two new settings were added under the **Network → SCEP Client** options to control the CA identity and HTTP path to the CA
5. Renamed **VPN → IPsec → Tunnels → Policies → Local network** setting to **Local traffic selector** along with a new **Dynamic** option which allows users to configure a local network by protocol and/or port instead of a network address range [DAL-5645]
6. Added new **VPN → IPsec → Advanced → Debug level** option to specify the logging verbosity of IPsec messages in the device system logs (default is debug logging is disabled) [DAL-5720]
7. **1002-CM06/1003-CM07**: Utilize T-Mobile carrier firmware if available for the cellular modem when using Sprint Curiosity SIMs [DAL-5466]
8. New cat Admin CLI command for displaying file contents [DAL-5853]
9. Update /etc/config/scep_client/ directory to be read/write by admin users
10. Add ability for policy-based routes to override routing of packets through VPN tunnels, useful in the case where you only want packets from a certain source network to go through the tunnel [DAL-5317]

BUG FIXES

The below bugs are all present on firmware versions 21.11.60.63 and older unless otherwise specified

1. Fixed HFSC class hierarchy setup for QoS policies to limit bandwidth used for shared links [DAL-5814]
2. Fixed issue preventing scheduled maintenance window from updating the maintenance_window datapoint in Digi Remote Manager if the maintenance window start time was between 00:00-00:59 [DAL-5765]
3. Fixed bug preventing MMS SMS messages from being received and parsed properly,

- preventing large out-of-band config changes from being received from central management portals [DAL-5538]
4. Fixed issue preventing transport-mode IPsec tunnels from initializing properly [DAL-5718]
 5. Fixed issue where only the first policy would be setup on IKEv2 IPsec tunnels [DAL-5347]
 6. Fixed issue preventing port forwarding firewall setups if the **Destination port(s)** setting was left blank [DAL-5860]
 7. Fixed intermittent issue where the **show dhcp-leases** CLI output would sometimes not include all leases [DAL-5688]
 8. Fixed system log errors when performing TACACS command authorization without having a TACACS server configured [DAL-5512]
 9. Fixed interruption of active serial port connections when a user changes the serial port mode in the Digi device's configuration settings [DAL-5698]
 10. Fixed issue where Surelink tests aren't reloaded if a user updates the network bridge or Wi-Fi configuration settings on the device [DAL-5406]
 11. Prevent modbus setup issue by not allowing users to configure the device to use reserved address ranges [DAL-5905]
 12. Fixed intermittent race condition in Surelink that could lead to a delay in setting up a WAN connection [DAL-5934]
 13. Fixed issue with digidevice.sms python module processing empty SMS messages [DAL-5883]
 14. Fixed issue preventing remote file system access to the /opt/ directory through Digi Remote Manager [DAL-5659]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a Critical CVSS score of **10 Critical**

1. Update python to version 3.10 [DAL-5499]
2. Update openssl to version 8.8p1 (CVE-2021-28041, CVE-2020-14145) [DAL-5451]
 1. This deprecates support for RSA signatures using the SHA-1 hash algorithm by default, which may prevent old machines from SSH-ing to the Digi device. Please ensure your SSH tool (TeraTerm, PuTTY, etc) is up to date. If you need to re-enable SHA-1 hash support, you can do so by adding the following lines to the **Service → SSH → Custom configuration → Configuration file** text box in the Digi device's configuration settings:
 1. HostkeyAlgorithms +ssh-rsa
 2. PubkeyAcceptedAlgorithms +ssh-rsa
3. Update dnsmasq to version 2.86 (CVE-2021-3448) [DAL-5331]
 1. Fix problem with DNS retries in 2.83/2.84
 2. Fix a problem, introduced in 2.83, which could see DNS replies being sent via the wrong socket. On machines running both IPv4 and IPv6 this could result in sporadic messages of the form "failed to send packet: Network is unreachable" and the lost of the query
4. Update to Linux kernel version 5.15 [DAL-5546]
5. Add new **Service → Web administration → Minimum TLS version** configuration setting to allow users to specify which TLS versions are allowed in the local web UI (default minimum is TLS 1.2) [DAL-5408]
6. Update busybox to version 1.34.0 [DAL-5631]
 1. CVE-2021-4237, CVE-2021-42374, CVE-2021-42375, CVE-2021-42376, CVE-2021-42377, CVE-2021-42378, CVE-2021-42379, CVE-2021-42380, CVE-2021-42381, CVE-2021-42382, CVE-2021-42383, CVE-2021-42384, CVE-2021-42385, CVE-2021-42386

7. Update dbus to version 1.13.20 [DAL-5459]
 1. CVE-2020-12049, CVE-2019-12749
8. Update grub to version 2.06 [CVE-2021-3418] (DAL-5456)
9. Update bzip2 to version 1.0.8 (CVE-2019-12900, CVE-2011-4089, CVE-2010-0405) [DAL-5446]
10. Update procps to version 3.3.15 [DAL-5433]
 1. CVE-2018-1124, CVE-2018-1123, CVE-2018-1126, CVE-2018-1125
11. Hardened openssl build to include secure compilation flags
12. Update sqlite to version 3.37.2 [DAL-5669]

VERSION 21.11.60.63 (December 8, 2021)

This is a **mandatory** release

Firmware	sha512sum	md5sum
AnywhereUSB2i-21.11.60.63.bin	8942608687788cb21466f5680fdd4f62b24916a8f8a3bf2eeb9d826a6eb3dbae99be34f52350535597dd9cae b4df92997f3d2c4db5eee139a87521f5c9d819d6	f19bfdb94f71a9c5dfafbb62fe2fb379
AnywhereUSB8-21.11.60.63.bin	c2fdf5548ba24ddf0b2fa32ffeba5cd7d68ffe10675bc689937b84bbe5082a80a0f975b8e457836b77a5385fe8d66649539eb5bcc3b3d95f8fa81d4e2684a524	d78a8ea580cb1635a96c7e086483af77
AnywhereUSB8W-21.11.60.63.bin	edc4ea6c046d56a498516773f94dad719c482cfbec8110e1bdf233fc2972a4bc2c8a8fe3bc2fa04b4c12f52314ce99f6df08be5506fc3c6a636298853f36f33	f8da19e940ac502b9e232ec65dc81675
AnywhereUSB24-21.11.60.63.bin	a6690828e353f527d817d21fcd9da33af4b3a53309d47632beff706a45688e5fc2783f0c66e20f22331eb7ce8da33cb3a1c52161d230ba1f0f7e80624f0aee7f	4adc750a2e30bdf7d802071e50198ee7
AnywhereUSB24W-21.11.60.63.bin	fa736f992747cad83efd5946f74061af74a6c8f20a0262697d10d498e7fc1cbd89d1286d8a540a1129c973ad23be37c3d9b52886976d55772dec6b10693e6eed	4995efbe6c44070c11422c3898af9835

FEATURES

1. New **System maintenance → Device firmware update** config option to allow the device to automatically update to new firmware when available (disabled by default) [DALP-630]
2. TACACS+ accounting and authorization for Admin CLI interactions [DALP-633]
 1. Includes two new configuration settings under the **Authentication → TACACS+** configuration settings for enabling TACACS command account and/or authorization
3. Add new **Authentication → Users → Username alias** option for providing an alternate username that can accommodate characters not typically allowed in a username [DALP-705]
4. PKI certificate-based authentication for WPA2/WPA3 Enterprise Wi-Fi client connections, including options for user-provided certificates or SCEP client integration for automatic certificate generation [DALP-828 & DALP-794]

ENHANCEMENTS

1. Improved Wi-Fi scanning tool on the **Status → Wi-Fi → Management** page in the web UI to automatically setup the underlying basic client-mode settings so the device can scan for nearby APs without requiring the user to first configure the client-mode settings [DALP-802]
2. New **show surelink** Admin CLI command for displaying details on the Surelink test(s) configured for a network interface or VPN tunnel [DALP-621]
3. Add new option under **Location → Destinations** for specifying the talker ID used in NMEA message strings [DAL-5038]
4. **1002-CMM1 CORE modems**: Use CID context 3 for any type of Verizon SIM when used with a

- ME910c1-WW modem [DAL-5428]
5. Include the mode indicator field in NMEA messages constructed when a GPS fix isn't obtained [DAL-5464]
 6. Add support for auto-completing a parameter or AT command provided to the **xbee set|get|execute** Admin CLI commands [DAL-5196]
 7. Change default IPsec IKE DH group to 14 for enhanced compatibility with industry standard settings [DAL-5344]
 8. Disable serial history in remote access mode by default [DAL-5494]
 9. Add new settings under cellular Surelink options to have the device reset the cellular modem if a specified number of Surelink tests fail [DAL-5441 & DAL-5485]
 10. Add **datapro** APN to fallback list to be utilized with Airmob SIM cards [DAL-5548]
 11. New **show containers** Admin CLI command for listing details about configured containers [DAL-5380]
 12. Include SIM ICCID and phone number in the query_state response sent to Digi Remote Manager [DAL-5632]
 13. Specify string encoding as UTF-8 in communication with DigiRM for compatibility with extended character sets [DAL-5505]

BUG FIXES

The below bugs are all present on firmware versions 21.5.56.176 and older unless otherwise specified

1. Fixed issue preventing IPsec tunnels from being setup in Transport mode [DAL-5490]
2. *1002-CM04/1002-CME4 CORE modems*: Fixed issue where cellular modem firmware updates would not be applied to Telit LE910-family of modules unless the firmware file included a carrier name in the filename [DAL-5616]
3. *1003-CM07 CORE modem*: Fixed issue preventing multi-carrier firmware updates on Sierra EM7411 modems [DAL-5473]
4. Fixed issue preventing **on boot** SIM preference schedule from taking effect (bug present on firmware versions 21.8.x and 21.5.x) [DAL-5547]
5. Fixed issue preventing internal firewall from functioning properly if a port forwarding rule was configured with the protocol type set to **other** (bug present on 21.8.x firmware) [DAL-5501]
6. Fixed issue preventing IPsec tunnels from being setup properly if the tunnel name was longer than 9 characters [DAL-5139]
7. Fixed formatting of cellular-related health metrics so they can be properly displayed under the *Settings* → *Status* → *Cellular* section in Digi Remote Manager [DALP-768]
8. Fixed error in system log when attempting to parse an empty config file [DAL-5402]
9. Fixed issue causing potential multi-minute delays in the *show modem name XX* Admin CLI command [DAL-5297]
10. Fixed issue where Surelink ping tests would utilize the same source IP address if coming from different network interfaces assigned to the same physical device/port [DAL-5478]
11. Fixed issue where Surelink **reboot** action would not be take if the Surelink **restart interface** action was also enabled [DAL-5485]
12. Fixed issue preventing the creation of config elements with dynamic array names via the local web API [DAL-5481]
13. Fixed issue preventing installation of sqlite3 python package via pip [DAL-5611]
14. Fixed issue preventing multiple config changes from being applied in a python script using the digidevice.config module [DAL-5192]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a Critical CVSS score of **9.8 Critical**

1. Update to python version 3.6.15 [DAL-3190]
2. Update stunnel to version 5.60 [DAL-5291]
3. Update busybox to version 1.33.1 [DAL-5290]
4. Update to Linux kernel version 5.14 [DAL-5360]
5. Update OpenSSL to version 1.1.1l [DAL-5242]
6. Fixed issue where the TACACS shared secret was included in the system logs [DAL-5470]
7. Update libunbound to version 1.13.2 [DAL-5420]
8. Update libidn2 to version 2.3.2 [DAL-5439]
9. Update muslv to version 1.2.2 [DAL-5452]
10. Update rsync to version 3.2.3 [DAL-5431]
11. Update OpenVPN to version 2.5.4 [DAL-5435]

VERSION 21.8.24.129 (September 13, 2021)

This is a recommended releases

AnywhereUSB2i-21.8.24.129.bin

SHA512:

ba0c17ebcff3fe1e47ca9a344110d8de809fd436467e433057a2f5873165c899118c08c8d
e9f18736c3a00f77cf86322a889bde6c77396b88dce0a4958b63f5f

MD5: 6173cdce7ef322fd697b18c38953c8ac

AnywhereUSB8-21.8.24.129.bin

SHA512:

162cc7d7d4b4ce2f629481cef57156442fe0f79427624fb8a099e4baf037ba098d1a243adf
2fca18b3e39eec3c1e08c98b1bebeceae37388963062b99c10d341

MD5: e32f0d23d45c5bc859f89ce5d8a1c0c7

AnywhereUSB24-21.8.24.129.bin

SHA512:

bdd3dec5e30a037a2c67100211ff7dbe2974b27656affb468235d2045ebe48ff055ecbc90f
87f1bad49e9c2f57b3e1e3b74cebf6690dd39945293f0465a7b6cc

MD5: 88d602e4a8f0d4340095499336c51ab5

ANYWHEREUSB-specific CHANGES

1. Updated awusbd service to fix the following [DAL-5088]
 1. Enable automatic registration of unknown client IDs so they can be shown in the Hub status display
 2. Add device address to POWER cycle log msg
 3. Hub service hangs if SSL handshake does not complete
2. Python scripting support, including the [digidevice python module](#) [DALP-763]

FEATURES

1. LXC container support for running localized containers on the device [DALP-243]
 1. New **System → Containers** configuration settings for provisioning containers, providing virtual networking, and serial port access from the container
 2. **lxc** commands available in the shell console for managing/accessing/monitoring containers on the device

3. Containers are based off the host DAL device's system. Packages installed to the container must be built for the CPU architecture designed
2. L2TPv3 static/unmanaged VPN tunneling [DAL-5137]
 1. VPN -> L2TPv3 ethernet configuration setting
 2. New Status -> VPN -> L2TPv3 Ethernet web UI page
3. 802.1x port-based network access control, configurable per network interface [DAL-5080]
4. New **Services** → **SSH** → **Custom configuration** settings for overriding or editing the SSH server options
5. New **Monitoring** → **Device event logs** options for sending local device event logs to Digi Remote Manager [DALP-808]
 1. Event logs are controlled under the **System** → **Log** → **Event categories** configuration settings
6. New **VPN** → **IPsec** → **Tunnels** → **IKE** → **IKE fragmentation** option to enable, disable, or force IPsec IKE fragmentation [DAL-4933]
7. New **MAC address allowlist/denylist** options to allow/deny packets based off of a range of source MAC addresses [DALP-799]
8. New **system time** CLI command for manually setting the local date and time [DALP-520]
9. New **monitoring metrics upload** CLI command for sending on-demand health metrics to Digi Remote Manager [DALP-727]
10. New **system script start** CLI command and **Status** → **Scripts** page in the web UI for manually starting custom scripts configured under the **System** → **Scheduled tasks** → **Custom scripts** settings with a **Run mode** of **manual** [DALP-741]
11. New **system find-me on|off** CLI command and **Status** → **Find Me** button in the web UI for flashing cellular-related LEDs to help locate the device onsite [DAL-5142]
12. New **Network** → **Bridge** → **switchport** bridge type configuration settings for enhanced VLAN capabilities [DAL-5220]
 1. trunked vs untrunked ports
 2. virtual switch setups
 3. VLAN layer 2 networking

ENHANCEMENTS

1. Added new **show l2tpeth** CLI command for viewing the status of any configured L2TPv3 tunnels [DAL-5220]
2. Update python pip to version 21.2.4 [DAL-5068]
3. Shortened fallback APN list by removing wildcard entries [DAL-5012]
4. 3G sunset support for EU carriers [DAL-5041]
5. Update messaging included in keepalive packets sent to Digi Remote Manager to prevent multi-second delays in keepalive responses [DALP-832]
6. Add **datapoint.upload_multiple** function to digidevice python module for uploading multiple datapoints to DigiRM at once [DALP-857]
7. Add **uptime** field to **show cloud** CLI output to indicate how long the device has been connected to Digi Remote Manager [DAL-1083]
8. Update **system support-report** CLI command to automatically store the support report in /var/log/ unless a path is specified [DAL-5027]
9. **system support-report** CLI command outputs helpful information for SCP-ing the file from the device to a remote destination [DAL-5027]
10. New **clear dhcp-lease** CLI command for removing all dynamic DHCP leases or certain DHCP leases based on MAC address or IP address [DAL-5127]
11. New **speedtest** CLI command for performing on-demand iPerf or nuttcp speedtests [DAL-

- 5040]
12. Require local users to be assigned to a group [DAL-5060]
 13. Add support for configuring multiple destination networks/interfaces for Multicast routes [DALP-853]
 14. New **Network → Advanced → Sequential DHCP address allocation** configuration setting for controlling if DHCP addresses are assigned sequentially or randomly (disabled by default) [DAL-5136]
 15. Persistent local date/time across reboots once a successful NTP sync occurs [DALP-806]
 16. New **System → Scheduled tasks → System maintenance → Maintenance window trigger** configuration settings for controlling when/if a device tells Digi Remote Manager it is in a maintenance window and if updates should be pushed to the device [DAL-5010]
Available maintenance window triggers are:
 1. Specified network interface is up
 2. Python API call
 3. Specific time window in the day
 17. Read/write control to the /opt/ and /etc/config/analyzer/ directories through DigiRM and the local web UI [DAL-5117]
 18. New options for setting up a custom default config file [DAL-4978]
 1. **system backup** CLI commands for generating a custom default config file based on the active config settings on the device
 2. **System → File System** page in the web UI for loading a configuration backup file as the custom default config
 3. **Files → Persistent files** folder accessible through Digi Remote Manager where users can upload a config backup, naming it custom-default-config.bin
 19. Add option to clear a custom default config by performing a double erase sequence [DAL-5017]
 20. Updated CLI login helptext to include common tool-tips [DAL-5157]
 21. Replace the cellular modem manufacturer name with the CORE modem model name in the CLI/webUI/metrics details [DAL-5171]
 22. Ensure scheduled reboots with the **reboot_managed** command cause graceful shutdown of services on the device before rebooting [DAL-5150]

BUG FIXES

The below bugs are all present on firmware versions 21.5.56.106 and older unless otherwise specified

1. Fixed issue where Digi Remote Manager would remediate a DAL device every time it's scanned due to the local user passwords being hashed [DALP-834]
2. Fixed issue where the **system restore** CLI command could default the device if the config backup file was store in the /etc/config/ directory [DAL-5116]
3. Fixed the local web API to allow values with spaces [DAL-5039]
4. Fixed the local web API to allow array configuration settings [DAL-4895]
5. Fixed mdns service where it would occasionally crash [DAL-4663]
6. Fixed issue preventing **modem pin status** from returning valid results [DAL-5056]
7. Fixed bug with installing certain python modules using pip [DAL-5068]
8. Set default user-base directory to /etc/config/scripts/ so python pip can install module dependencies to a writeable location when pip install --user <module_name> is invoked [DAL-5068]
9. Prevent serial connection crashes when a incoming serial socket connection is sending so much data that the buffer fills up the system memory

SECURITY FIXES

1. Add STS header in HTTPS web UI [DAL-4991]
2. Update libcurl to version 7.77.0 (CVE-2021-22897, CVE-2021-22898, CVE-2021-22901)
3. Update to Linux kernel version 5.12

VERSION 21.5.56.106 (May 31, 2021)

This is a mandatory release

AnywhereUSB2i-21.5.56.106.bin

SHA512:

b1eb4ec2a2f20d78974bc93f3c412d8a045dcb652653eea59ee0c3a8112055e5a21b9756
9c65a4b3d8a9ddb289263178ece66abb2bf6b49bb998ba8d9962b365

MD5: f8ce2e9a8847d7f700aa4e4b4d00a8e1

AnywhereUSB8-21.5.56.106.bin

SHA512:

c196aa8fd575a95b4d59e9ebbc38dc14515c905decc5902184989aea4ee96941dba2fb10
e02fbd0bb994c22ef16de32f384efb65d3b2606b9e32d1d8ded7ed

MD5: 3560581d5f4a0fbc436ab0a566f91069

AnywhereUSB24-21.5.56.106.bin

SHA512:

af24fbc4cfbc503fcb12af128655576869b82519489df2573b80908b98fbb2619caacccd6d0
43b2dac5b16e13c9e98b1a5d88acf49be99062a33e7301edcd2a9

MD5: 98b9a3a51a0bc55abf2ea9f07f019eb9

ANYWHEREUSB-specific CHANGES

1. Add CLI and web UI options for power cycling USB ports [DALP-792]
 1. **Power cycle not supported by 24-port with SKU less than 50001982-03**
 2. CLI command: **system anywhereusb powercycle port[n]**
 3. Web UI: **Cycle** button listed for each USB port on the **Status → AnywhereUSB** page
2. Fixed issue with Surelink behavior on AnywhereUSB Plus devices with multiple Internet connections (bug present on firmware versions 21.2.39.67 through 20.5.x) [DAL-4847]

FEATURES

1. Added options under **VPN → IPsec → tunnels → Remote** endpoint to add multiple endpoints and either round-robin between the endpoint or randomly select an endpoint to establish the tunnel to [DALP-160]
2. Added options under **VPN → IPsec → Advanced** to control IKE retransmit interval, IKE timeout, tunnel retry interval, and tunnel retry timeout [DALP-564]
3. New Surelink configuration options [DALP-787, DALP-274, & DALP-84]
 1. **Restart fail count** and **Reboot fail count** options to specify how many times the Surelink test must run and fail before a reboot/restart action is taken
 2. **Pass threshold** option to specify the number of times Surelink tests must pass before the interface is marked as working
 3. New **Test another interface's status** test type to pass/fail Surelink based on whether another network interface is up/down and has IP connectivity
4. SNMPv2c read-only support [DALP-809]
5. Enable SCEP client support for IPsec tunnel authentication [DALP-722]
6. Add **Scan** button on the Modem status page to initiate a network scan, list available carriers the SIM can connect on, and allow the user to select a particular PLMN/network to use [DAL-4338]
7. Add default **digi.device** local domain for simpler SSH/web access [DAL-4598]
 1. Requires using the Digi device as your DNS server for resolving digi.device to an IP address

ENHANCEMENTS

1. Add **System → Scheduled tasks → Reboot window** config option to add a random delay to the **Reboot time** if configured [DAL-4741]
2. Add read-only console access via Digi Remote Manager [DALP-336]
3. Add support for receiving additional remote commands from Digi Remote Manager:
 1. Perform a speed test and send the results to DigiRM [DALP-490]
 2. Perform automated cellular modem firmware update [DAL-4850]
4. Add option to retain the unique default password of the admin user when initially configuring the device [DALP-758]
5. Improved **Firewall → Port forwarding** options to support a range of ports, including 1:1 and many-to-one port mappings [DALP-560]
6. Added options to control packet filtering for the **Network → Analyzer** traffic analyzer [DALP-733]
7. Update voice settings on Telit and Quectel modems for continued connectivity after AT&T's 3G network sunset in February 2022 [DALP-760]
8. Add internet.gma.iot T-Mobile APN to fallback list [DAL-4906]
9. Support for Sierra cellular modem firmware with multiple CWE files in a single tarball [DAL-4860]
10. Include error messages along with error code if an issue is encountered when downloading device or cellular modem firmware [DAL-4854]
11. Added **Authentication → LDAP → Login attribute** configuration option to control the attribute ID used so it can match with the attribute set in an Active Directory server [DALP-120]
12. Update the titles of the columns in the **show dhcp-lease** CLI output to be more descriptive
13. Add **show dns** CLI command to display the active DNS servers and what interface they're associated to [DAL-3639]

14. Add **show ntp** CLI command to display the status of the NTP service and if it has synced with an external time server [DAL-4747]
15. Add **system firmware ota** commands to check, list, and update to new firmware from the Digi firmware server [DAL-4800]
16. Skip Auto-APN detection and use internet.telekom APN by default for Deutsche-Telekom SIMs [DAL-4622]
17. Add LWM2M parameters to include AT&T Host IDs for devices with EM9191/LM940/LM960 modems [DAL-4823, DAL-4844, & DAL-4845]
18. Update from Quagga to FRRouting for BGP OSPF, RIPNG, and other routing services [DAL-4798]
19. Update python to version 3.6.13 [DAL-3190]
20. Return proper status code for custom scripts configured on the device [DAL-4670]
21. Rename MAC address filtering options to be called **Allowlist** and **Denylist** [DAL-4677]

BUG FIXES

The below bugs are all present on firmware versions 21.2.39.67 and older unless otherwise specified

1. Fixed issue when authenticating users if multiple TACACS servers were configured and the first server is unresponsive [DAL-4748]
2. Clear PDP cid 1 APN for Verizon SIMs using a vzwentp private APN with a ME910c1-WW modem [DAL-4525]
3. Fixed issue preventing devices with LM940 modems from automatically connecting with T-Mobile Hungary SIMs [DAL-4679]
4. Fixed issue where outbound SMS messages couldn't be sent using various carrier SIM cards (bug present on firmware versions 21.2.39.67 through 19.11.x) [DAL-4794]
5. Fixed issue where cellular connectivity wouldn't re-establish if a Quectel modem reset itself [DAL-4612]
6. Fixed issue where the device could stop participating in RIP routing if network interfaces are reset [DAL-4704]
7. Fixed issue where RIP, BGP, and other routing services would not setup properly if a user updated the configuration for the routing services on the device [DAL-4784]
8. Fixed issue preventing acceptance of default routes advertised via RIP [DAL-4799]
9. Fix issue preventing GRE interfaces from being specified within BGP and other routing services [DAL-4695]
10. Fixed issue preventing VPN tunnels from being specified within port forwarding rules [DAL-4524]
11. Fixed issue preventing configuration options from being applied en-masse from the CLI when using the output from the **show config cli_format** command [DAL-4713]
12. Fixed bug where a running network analyzer could be stopped in the CLI by issuing **Ctrl-C** [DAL-4652]
13. Fixed issue where GPS-based location health metrics weren't being sent to Digi Remote Manager (Bug present on firmware versions 21.2.x) [DAL-4310]
14. Fixed issue where the status of an OpenVPN client wasn't listed properly in the web UI [DAL-4357]
15. Fixed issue preventing access to multiple remote networks through an IPsec tunnel with the same policy [DAL-4816]
16. Fixed issue preventing multi-VRRP setups from setting up with the proper priority [DAL-4824]
17. Fixed issue where devices could try recovering Sierra modems in the middle of a modem firmware update [DAL-3929]

18. Fixed issue where wired Internet connectivity is interrupted during cellular modem firmware updates [DAL-4647]
19. Removed broken Babel routing service (bug present on firmware versions 21.2.39.67 through 19.11.x) [DAL-4769]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a Critical CVSS score of **9.8 Critical**

1. Reduce password complexity to 8-character minimum [DAL-4506]
2. Update to OpenSSL 1.1.1k [DAL-4755]
 1. CVE-2021-3450 CVE-2021-3449
3. Update libcurl to version 7.76.0 [DAL-4774]
 1. CVE-2021-22876
CVE-2021-22890
4. Update net-snmp to version 5.9 [DAL-4669]
 1. CVE-2018-18066
5. Update tcpdump to version 4.99.0 [DAL-4587]
 1. CVE-2018-10103 CVE-2018-10105 CVE-2018-14461 CVE-2018-14462 CVE-2018-14463
CVE-2018-14464 CVE-2018-14465 CVE-2018-14466 CVE-2018-14467 CVE-2018-14468
CVE-2018-14469 CVE-2018-14470 CVE-2018-14879 CVE-2018-14880 CVE-2018-14881
CVE-2018-14882 CVE-2018-16227 CVE-2018-16228 CVE-2018-16229 CVE-2018-16230
CVE-2018-16300 CVE-2018-16451 CVE-2018-16452 CVE-2019-15166
CVE-2020-8037
6. Reduced listening network services to least-privilege access [DAL-4703]
7. Removed weak SSH algorithms and protocols [DALP-817]
 1. **Removed MAC Algorithms:** umac-64-etm@openssh.com, hmac-sha1-etm@openssh.com, umac-64@openssh.com, hmac-sha1
 2. **Removed Key Exchange Algorithms:** diffie-hellman-group16-sha512, diffie-hellman-group18-sha512, diffie-hellman-group14-sha256

VERSION 21.2.39.67 (February 27, 2021)

This is a mandatory release

AnywhereUSB2-21.2.39.67.bin

SHA512:

ecb60aaf5e2eafb09dee1570a623927d25d95577e6f81c9c30ab3cc3e66ad185b5af942fd
18180dd0f8e861619daa604e8b89944c3d7d533acbd67ab5b5ed854

MD5: 5c2626626d284b8e11a69568471e19c3

AnywhereUSB8-21.2.39.67.bin

SHA512:

81bc19d6e8c0770b34a2209948c705d5cd7570b6967aba163b03829f9dbc4fc5251aa215
7f13d3f19e77b2092b743c3f8504e3f54cb846c9e1a3a8adcb527907

MD5: 48850d03ed59f6b5dc73cde722bb6fe8

AnywhereUSB24-21.2.39.67.bin

SHA512:

28123deaebbe39239085390598684bf960620610ab933c129f1961ad99d9441849677f30
6ef41a1f9d90433310fa0fae5e11e025ffe5d8aada3c19f3f48caaa4

MD5: 9718ed57ba1b24c136cc75a219b4a739

ANYWHEREUSB-specific CHANGES

1. Updated default keepalive timeout for the AnywhereUSB service from 11-seconds to 20-

- seconds [DAL-4630]
2. *AnywhereUSB 8 Plus*: Fix broken link to User Guide [DAL-4436]

FEATURES

1. Add the Location service to all DAL products. DAL devices can utilize several location sources (cellular, GNSS, or user defined) to determine where it's located and report that to Digi Remote Manager or other servers [DAL-724]
2. Add geo-fencing configuration options. This new features is found under **Services → Location → Geofence**. It can be utilized to define one or more circular or polygonal geo-fence areas and then perform a set of actions when the device enters or leaves that area. Current options for actions to perform are either factory erasing the device or running a custom script. [DALP-711]
3. New **modem scan** CLI command for listing available carriers for the current modem and SIM setup.
4. New **Network → Interface → Modem → Network PLMN ID** config setting to lock the SIM card to a particular carrier based on its PLMN ID(note that the **Carrier selection mode** must be set to **Manual** or **Manual/Automatic** in order to lock the SIM to a specific carrier) [DALP-637]
5. Added local API to the web UI for automated configuration of the device [DALP-777]
6. Support remote CLI commands through Digi Remote Manager [DAL-4273]
7. New configuration options under **System → Scheduled tasks → System maintenance** to automatically check for device and modem firmware updates, then notify in the CLI and web UI when updates are available [DAL-4413]

ENHANCEMENTS

1. Allow hidden/debug config settings to be controlled and preserved by DigiRM [DAL-4445]
2. Asymmetric preshared keys for IPsec tunnels [DALP-707]
3. Don't display Aggressive/Main mode or Xauth selections for IKEv2 IPsec tunnels [DAL-4142]
4. Update name and description of certificate settings for OpenVPN clients and servers [DAL-4435]
5. Add digidevice.led python module to all products [DALP-710]
6. Add options to forward location information to a remote host over TCP [DALP-778]
7. Add new **Forward interval multiplier** configuration option under **Services → Location → Destination servers** to control the number of location update intervals to wait before sending location data to this server [DAL-4056]
8. Report location metrics as datapoints to DigiRM [DAL-4055]
9. Include the connection uptime of IPsec tunnels as datapoint metrics to Digi Remote Manager [DAL-4062]
10. Add iptables TRACE tool for enhanced firewall debugging [DAL-4182]
11. Improved accuracy of the status shown for a modem during a firmware update

BUG FIXES

1. Fixed issue where non-primary DNS were queried through the wrong interface when **use_dns** configuration option is set to primary [DAL-3156]
2. Report the phone number of the SIM as a health metric datapoint to Digi Remote Manager [DAL-4440]
3. Fixed incorrect format of ICCID and IMEI metrics reported to Digi Remote Manager [DAL-4440]
4. Fixed setup issue between custom firewall rules and IPsec tunnels [DAL-4433]

5. Fixed occasional issue preventing LM940 modems from re-establish their cellular connection after a modem firmware update [DAL-2933]
6. Fixed issue requiring a user to fix syslog configuration setting when updating from 20.5.x or older firmware to 20.8.x/20.11.x firmware [DAL-4426]
7. Fixed rare issue where **show system** CLI command would display incorrect uptime details [DAL-4350]
8. Fix issue with secondary CLI sessions showing stale configuration settings if the config is updated elsewhere [DAL-4446]
9. Updated message displayed in web UI to direct the user to refresh the page after erasing the device back to default settings [DAL-2326]
10. Fixed issue where dynamic DHCP leases were not displayed in the CLI or web UI (bug present on 20.11.x firmware versions) [DAL-4557]
11. Fixed inaccurate status of the Ethernet interface of a device in passthrough mode [DAL-4543]
12. Fixed issue preventing web UI access if two-factor authentication was enabled (bug present on 20.11.x firmware versions) [DAL-4509]
13. Fixed issue where CLI commands sent from DigiRM would crash the DAL device's connection to DigiRM [DAL-4412]
14. Fixed issue preventing WAN/cellular connections from working if the interface was configured with a single **Interface Up** Surelink test [DAL-4629]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a Critical CVSS score of 8.1 High

1. Update libcurl to version 7.74.0 (CVE-2020-8169, CVE-2020-8177) [DAL-4336]
2. Update to python version 3.6.12 (CVE-2020-14422) [DAL-4364]
3. Update OpenSSL to version 1.1.1i (CVE-2020-1971) [DAL-4326]
4. Update dnsmasq to version 2.83 (CVE-2019-14834, CVE-2020-25681, CVE-2020-25682, CVE-2020-25683, CVE-2020-25684, CVE-2020-25685, CVE-2020-25686, CVE-2020-25687) [DAL-3950]
5. Update web security settings with the following headers [DAL-4192]
 1. Pragma: no-cache
 2. Content-Security-Policy
 3. X-Content-Type-Options: nosniff
 4. X-XSS-Protection: 1; mode=block
6. Set SAMEORIGIN in X-Frame-Options to uppercase [DAL-4192]
7. Automatically de-activate active user logins/sessions if the password for that user changes
8. Removed support for https CBC ciphers [DAL-4408]
9. Fixed XSS vulnerability on serial page in the local web UI (Bug present on firmware versions 20.11.x and older) [DAL-4646]

VERSION 20.11.32.168 (December 23, 2020)

This is a recommended release

AnywhereUSB2-20.11.32.168.bin

SHA512:

```
1e58f363db72d07d008e4709e41ea536dd1d704de676ef88acd4c75c664ff3d075b951cc1
bb2c7442f5d889d66f04466258394c5b0fe27ec5d9c989cf7104852
```

MD5: 77b1055fda97bddcb1dd2d7d20d5fb04

AnywhereUSB8-20.11.32.168.bin

SHA512:

0e66a03cb5954fc7ec4967c6abc906cf96f67ffbbbc182102a634e74083eacb077a54f97d3
ca73d8914f4ad509c523e2a9525375a8d0217b2c12582f7b2bb6e7

MD5: 9c46957e97fe5fe6d8e47cfda7da1231

AnywhereUSB24-20.11.32.168.bin

SHA512:

075bf62b1a437d42da97c3cd52985635da89c1d99e3315060a15daa03f7cf740db2520a9
b239c3f17286ac6fbc7948ffb2a089d5584671ef8b83e76c41e4930d

MD5: 39a28482fe0e629b831424bf7e1d874e

ANYWHEREUSB-specific CHANGES

1. Fixed bug preventing large-sized USB traces from being saved properly (affects firmware version 20.11.32.139) [DAL-4422]
2. Fixed bug preventing USB trace initiated from the CLI from saving (affects firmware version 20.11.32.139) [DAL-4421]

ENHANCEMENTS

1. Use PDP context 1 with Telus carrier SIMs [DAL-4332]

BUG FIXES

1. Fixed bug preventing Ethernet speed/duplex adjustment (affects firmware version 20.11.32.139) [DAL-4414]

VERSION 20.11.32.138 (December 2, 2020)

This is a **mandatory** release

AnywhereUSB2-20.11.32.138.bin

SHA256: de5bb74d7dabf56ae2637e3b12ad5b90a3ad0c799102202fc72c92db0fa4a390

MD5: 7b1bb4ea725366ba65da5714c6d67df9

AnywhereUSB8-20.11.32.138.bin

SHA256: d9b1d985da0420998fe2f4feb1b464bda2f73bcc442874555658d1141e466e8b

MD5: d634c879bd13264ff8854e917a2e8bb4

AnywhereUSB24-20.11.32.138.bin

SHA256: d53e3c9863e2827db0b08eaaa5666f16df584b53236c303b8e62b28237f7013a

MD5: bc32f136c562de23946acd25057e46c7

ANYWHEREUSB-specific CHANGES

1. Update AnywhereUSB service to recognize additional USB devices, including Hamilton Microlab Starlet USB devices [AWG3-2527]
2. Fixed race condition in starting the AnywhereUSB Manager service if the device had WAN bonding enabled (bug affects firmware versions 20.8.x and older) [DAL-4114/DAL-4231]
3. Address memory leaks causing awusb manager service to crash over time (bug affects firmware versions 20.8.x and older) [DAL-4043/DAL-3793]
4. Fixed behavior of the WWAN Service LED to blink when a modem firmware update is in progress (bug affects firmware versions 20.8.x and older) [DAL-3963]
5. Fixed exploit through firmware update process (CVSS score 6.0 Medium CVSS:3.1/AV:L/AC:L/PR:H/UI:N/S:U/C:H/I:H/A:N) [DAL-4255]
6. Add AppArmor to AnywhereUSB Plus products (CVSS score: n/a) [DAL-4248]

FEATURES

1. Add **ssh** and **telnet** commands to Admin CLI [DALP-664]
2. Add new **modem firmware** CLI commands for performing local or over-the-air remote firmware updates to the cellular modem(s) in the device [DAL-2811]
3. Add new configuration options under **Network → Devices** for setting the link speed/duplex of the device's Ethernet port(s) [DALP-135]
4. Support for the Sierra EM9190/9191 5G modems [DALP-686]
5. Support for the Sierra EM7411 LTE CAT7 modem [DALP-608]
6. IPv6 IPsec tunnel support for full IPv6 tunnels, IPv6-over-IPv4, or IPv4-over-IPv6 tunnels [DALP-581]
7. IPsec XFRM interfaces for enhanced control over IPsec tunnels and the network interfaces associated to them. This allows users to select tunnels for multiple networking features, including static routes, policy-based routes, access control lists, and routing priority based on metric. [DAL-490]

ENHANCEMENTS

1. Add **Services → Location** options for configuring GPS or GNSS location communication [DALP-724]
2. GPS/GNSS support for the Quectel EG25-G modem [DALP-713]
3. Add cellular technology icon to the Dashboard in the web UI [DAL-3673]
4. Add link to product User Guide under the User drop-down menu at the top-right of the web UI [DALP-569]
5. Added help button to **System → File System** page of the web UI [DALP-569]
6. Updated **show modem** CLI command to display historical information about the modem if it is in the process of updating firmware [DAL-1504]
7. Added new **Services → Ping responder** configuration settings for controlling what interfaces and firewall zones the DAL device responds to ICMP requests on [DAL-1565]
8. Enhance IPsec tunnels to wait for passing Surelink tests (if configured) before initiating outbound tunnels [DAL-3878/DAL-3774]
9. Add m2m.telus.iot Telus APN to fallback list [DAL-3911]
10. Add psmtneorm and edneopate010.dpa AT&T APNs to fallback list [DAL-4041/DAL-4045]
11. Add reseller and tracfone.vzwentp Tracfone APNs to the AT&T and Verizon fallback lists [DAL-4098]
12. Add new 890103 and 890141 ICCID prefixes and 31030 PMND ID matchers to AT&T APN fallback list [DAL-3934/DAL-4041]
13. Add service.qcdm.secure option to enable/disable encrypted QXDM access to the cellular modem in the DAL device [DAL-3964]
14. Add missing modem firmware and SIM details to datapoints uploaded to Digi Remote Manager [DAL-4040]
15. Show uptime for connection to Digi Remote Manager on the Dashboard web UI page in days/hours/minutes/seconds instead of just minutes [DAL-3691]
16. Updated network bridges to use the MAC address of the first device listed in **Network → Bridges → [bridge_name] → Devices** as the MAC address for the bridged interface [DAL-3949]
17. Add link in the firmware update window on the **Status → Modem** page to direct users to the configuration options to schedule a modem firmware update [DALP-725]
18. Updated the help text on the login page to provide a more generic image [DAL-3916]
19. Removed duplicate modem signal information from the **Modem → Status** page [DAL-3680]
20. Added a **DSCP** option to policy-based routes to allow users to match the routing rule by the type of DSCP field in the packet [DAL-3867]

21. Added a **defaultroute** option for matching policy-based routes to the device's active default route [DAL-4130]
22. Hide the **Monitoring → Device Health** configuration options if the device is not enabled for Digi Remote Manager central management [DAL-3825]
23. Update header types for the cellular modem name and network type on the Dashboard page
24. Create system log when Surelink DNS tests are skipped because the interface doesn't have any DNS servers [DAL-4224]
25. Hide main/aggressive mode option when using IKEv2 [DAL-4142]

BUG FIXES

1. Fixed missing default settings in configuration profiles created in Digi Remote Manager (bug affects firmware versions 20.8.x and older) [DALP-658]
2. Fixed missing option for setting the **SIM Slot Preference** in configuration profiles in Digi Remote Manager (bug affects firmware versions 20.8.x and older) [DAL-3912]
3. Fixed format of user passwords when displayed in Digi Remote Manager (bug affects firmware versions 20.8.x and 20.5.338.58) [DAL-3889]
4. Fixed issue with policy-based routing not working in conjunction with multiple IPsec tunnels (bug affects firmware versions 20.8.x and older) [DAL-3515]
5. Fixed issue preventing OpenVPN server-managed certificates from being re-generated if the process was interrupted (bug affects firmware versions 20.8.x and older) [DAL-3803]
6. Fixed issue preventing OpenVPN client from using an autogenerated config file from a tap-bridge openvpn server (bug affects firmware versions 20.8.x and older) [DAL-3881]
7. Fixed some formatting output of the **show system verbose** CLI command (bug affects firmware versions 20.8.x and older) [DAL-3805]
8. Fixed issue preventing VRRP interoperability between DAL devices and SarOS devices (bug affects firmware versions 20.8.x and older) [DAL-4130]
9. Update VRRP+ to properly handle changes in network interface statuses bug affects firmware versions 20.8.x and older) [DAL-4274]
10. Removed poorly formatted script contents from the **show scripts** CLI command output [DAL-3315]
11. Fixed non-working **system disable-cryptography** CLI command [DAL-4169]
12. Fixed second-stage erase functionality on devices not enabled for aView management [DAL-3944]
13. Fixed issue preventing multicast traffic from being sent through a GRE tunnel [DAL-3879]
14. Fixed issue preventing a firewall rule from being setup for OSFPv2 entries [DAL-3869]
15. Fixed rare crash caused when a Quectel modem disconnected [DAL-3867]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a Critical CVSS score of **9.1**

1. Disallow TCP forwarding from incoming SSH connections [DAL-3938]
2. Remove sensitive information from HTTP GET requests (CVSS score: 5.7 Medium CVSS:3.1/AV:N/AC:H/PR:H/UI:R/S:U/C:H/I:H/A:N) [DAL-3938]
3. Update to linux kernel 5.8 (CVSS score: 3.7 Low CVE-2020-16166 CVSS:3.1/AV:N/AC:H/PR:N/UI:N/S:U/C:L/I:N/A:N) [DALP-678]
4. OpenSSH updated to version 8.3p1 (CVSS score: 2.2 Low CVSS:3.1/AV:N/AC:H/PR:H/UI:N/S:U/C:L/I:N/A:N) [DAL-3299]
5. OpenSSL updated to version 1.1.1h (CVSS score: n/a) [DAL-4037]

6. OpenVPN updated to version 2.4.9 (CVSS score 9.1 Critical [CVE-2018-7544](#) CVSS:3.0/AV:N/AC:L/PR:N/UI:N/S:U/C:H/I:N/A:H) [DAL-3862]
7. Linux shell/bash updated to version 5.0 (CVSS score: n/a) [DAL-3763]
8. jQuery updated to version 3.5.1 (CVSS Score: 6.1 Medium [CVE-2020-11022](#) [CVE-2020-11023](#)) [DAL-3547]
9. Updated WebU session token to use AES-256-GCM cipher (CVSS score: n/a) [DAL-4000]
10. Prevent web asset access from unauthorized logins (CVSS score: 5.3 Medium CVSS:3.1/AV:N/AC:L/PR:N/UI:N/S:U/C:L/I:N/A:N) [DAL-3835]
11. Add script CSP headers to the web UI (CVSS score: n/a) [DAL-3629]
12. Removed QR code generator from the **Authentication → Users → Two-factor authentication**, as Content-Security-Policy requirements prevent access to resources not served by the device's web UI [DAL-3629]
13. Added extra layer of firmware verification to ensure the firmware matches the target hardware variant and prevent firmware modifications (CVSS score 1.9 Medium CVSS:3.1/AV:L/AC:H/PR:H/UI:N/S:U/C:N/I:L/A:N) [DAL-3511]
14. Prevent command injection through modemadvanced, modem_install, and firmware webpages (CVSS score: 6.8 Medium CVSS:3.1/AV:N/AC:H/PR:N/UI:R/S:U/C:H/I:H/A:N) [DAL-4093/DAL-4104/DAL-4046]
15. Prevent manual addition of files to an encrypted filesystem outside of the device itself (CVSS score: 6.1 Medium CVSS:3.1/AV:P/AC:L/PR:N/UI:N/S:U/C:N/I:H/A:H) [DAL-4149]
16. Restrict memory allocation of tcpdump (CVSS score: 7.5 High [CVE-2020-8037](#) CVSS:3.1/AV:N/AC:L/PR:N/UI:N/S:U/C:N/I:N/A:H) [DAL-4226]

VERSION 20.8.22.32 (August 28, 2020)

This is a **mandatory** release

AnywhereUSB2-20.8.22.32.bin

SHA256: cfabefbc02e6e81f1b112a278a411fbd275a95af1a38852026bf9840b31b61ee

MD5: 31aaa3f715136cada4fda5a149b9f45b

AnywhereUSB8-20.8.22.32.bin

SHA256: 0fbab85974ffa70fe178c081122a14d7e0649cf34ae9191fd241e226a9cf711a

MD5: 68befc0e9d4de7a1ab6e7dbf120a16fe

AnywhereUSB24-20.8.22.32.bin

SHA256: a2a29213c7b32731214ca86e417ae64b9ea369a11f98d8439071017e3e7005f0

MD5: 36d204c06955bfe53e63912a50ca79a0

ANYWHEREUSB-specific CHANGES

1. **AnywhereUSB 24 Plus only:** Added Ethernet network bonding to allow the same MAC address and IP configuration to be shared for multiple physical Ethernet ports in either active/backup or round-robin mode [DALP-589]
 1. Configuration options found under **Network → Interfaces → Ethernet bonding**. Bond devices created here can then be assigned to network interfaces
2. Added keep-alive interval and keep-alive timeout configuration options along with an option to set custom configuration options to the **Services → AnywhereUSB Manager** settings [DAL-3400 & DALP-442]
3. Fixed issue preventing switching SIM slots on AnywhereUSB Plus devices with a CORE modem [DAL-3571]

FEATURES

1. Add ability to load custom factory config file from the local filesystem, which if present is loaded when the device is reset to default settings [DALP-394]
 1. The config file is the same as what can be downloaded when a user saves/exports the configuration from the **Configuration Maintenance** page in the local web UI. That .bin config file can be placed in /opt/custom-default-config.bin
2. DMNR Verizon Private Network support with new settings under **VPN → NEMO** [DALP-457]
3. VRRP+ options added under **Network → VRRP → VRRP+** for validating primary or backup connectivity and automatically changing VRRP priority [DALP-289]
 1. Note a SureLink test must also be enabled for the network interface the VRRP entry is assigned to
4. Cisco Umbrella content filtering options added under **Firewall → Web filtering** service configuration section [DALP-524]

ENHANCEMENTS

1. Disable voice services on Quectel EC25-AF when using T-Mobile SIMs [DAL-3707]
2. Add **-I** source address option to the ping CLI command [DAL-3682]
3. Add **Central management** configuration options for any DAL product to sync with aView, ARMT, or AVWOB [DALP-626]
4. Add **4GM** and **4GT** options to the **Network->Modems->Access technology** settings to specify a CAT-M modem to only connect on LTE CAT-M1 or NB-IoT, respectively [DALP-472]
5. Add options under **System → Log → Server list** to allow users to specify the TCP/UDP protocol and port of the remote syslog server [DALP-593]
6. Added new **Monitoring->Device Health->Data point tuning** configuration options to fine tune what datapoints are uploaded as health metrics to Digi Remote Manager
7. Added new **Monitoring->Device Health → Only report changed values to Digi Remote Manager** option to control sending metrics to Digi Remote Manager on the basis of whether the values have changed since they were last reported [DAL-3386]
8. Reduced data usage by 80% (based on default settings) for reporting health metrics to Digi Remote Manager [DAL-3394]
9. Fade **Configuration saved** pop-up window 5 seconds after clicking the **Apply** button [DAL-3451]
10. Added new **Status → Scripts** page in the web UI to view custom scripts and applications configured in the device, along with their status (running vs idle) [DALP-533]
11. Add options in CLI to show and manually stop any custom scripts or applications [DALP-533]
12. Added **Duplicate firmware** option on the Firmware Update page in the local web UI to copy the active firmware to the secondary firmware partition [DALP-565]
13. Add **system duplicate-firmware** CLI command to copy active firmware to the secondary firmware partition [DALP-565]
14. Move **update firmware** CLI command to be under **system** [DAL-3092]
15. Add **show vrrp** CLI command to display the status of any configured VRRP instances [DAL-2953]
16. Use a random unprivileged port for performing ntp time syncs if standard port 123 fails [DAL-3650]
17. Added new **Authoritative** option under TACACS+, RADIUS, and LDAP user authentication methods to prevent falling back to additional authentication methods if enabled [DAL-3314 & DALP-540]

18. Update to ModemManager 2020-05-19 [DAL-3254]
 1. libqmi: updated to 1.25.4+
 2. libmbim: updated to 1.20.4+
 3. libgudev: updated to version 233
 4. Improved support for Quectel EC25/EG25 modules

BUG FIXES

1. Fixed issue preventing 1002-CMG4 modem from connecting with Verizon private APN SIMs [DAL-3276]
2. Fixed issue where device would remain connected to Digi Remote Manager even after cloud.service was changed to aView or disabled. Rebooting the device previously resolved the issue [DAL-3504]
3. Fixed bug where IPsec tunnels with multiple policies would only properly route traffic for the last policy configured [DAL-3448]
4. Fixed missing CPU usage stats in **show system** CLI output [DAL-2540]
5. Fixed improper value of the active SIM slot in the **modem sim-slot show** CLI command output when SIM slot 2 was in use [DAL-3569]
6. fix issue preventing network interfaces from initializing if the interface name was longer than 7 characters [DAL-2327]
7. Fixed issue preventing WAN passthrough mode if WAN was configured with a static IP [DAL-3097]
8. Fixed errors displayed in CLI when configuring a USB serial port in remote access mode [DAL-3207]
 1. **Note:** USB ports configured in application mode are not available to or manageable via the AnywhereUSB protocol or features of this product
9. Fixed issue preventing users from configuring an IP address as a remote syslog server [DAL-3433]
10. Handle incorrect value occasionally returned by by Telit LM940/LM960 module when querying to see which SIM slot is in use [DAL-3481]
11. Fixed issue preventing cellular modem connectivity if a custom gateway/subnet was configured but the modem wasn't in passthrough mode [DAL-3585]
12. Fixed permission issue on /opt/custom/ directory preventing users from setting up custom CSS and logos [DAL-3710]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a High CVSS score of **6.7**

1. Update to Linux kernel 5.7 (CVE-2020-10732 CVSS Score: 4.4 Medium [CVSS:3.1/AV:L/AC:L/PR:L/UI:N/S:U/C:L/I:N/A:L](#)) [DAL-3322]
2. Added local user login rate limiting to default lockout additional login attempts for 15 minutes after 5 login failures per user (Score: 6.7 Medium [CVSS:3.1/AV:L/AC:H/PR:N/UI:N/S:U/C:H/I:H/A:N](#)) [DAL-3390 and DAL-3505]
 1. New configuration options are under the **Login failure lockout** section for each user in the **Authentication → User** settings
3. Prevent /etc/config/start from running when shell is disabled (Score: 5.2 Medium [CVSS:3.1/AV:L/AC:H/PR:H/UI:N/S:U/C:H/I:L/A:L](#)) [DAL-2846]
4. Prevent file path expansion on **Firmware Update** and **File System** pages in the local web UI (Score: 3.2 Low [CVSS:3.1/AV:L/AC:L/PR:H/UI:N/S:U/C:L/I:N/A:N](#)) [DAL-3513, DAL- 3471, & DAL-3518]
5. Obfuscate text when showing the SIM PIN (Score: 3.2 Low

[CVSS:3.1/AV:L/AC:L/PR:H/UI:N/S:C/C:L/I:N/A:N](#) [DAL-3462]

6. Set HTTP Auth Cookie as secure in the local web UI (Score: 3.1 Low
[CVSS:3.1/AV:N/AC:H/PR:N/UI:R/S:U/C:N/I:L/A:N](#)) [DAL-3393]

VERSION 20.5.38.58 (July 20, 2020)

This is a **mandatory** release

AnywhereUSB2-20.5.38.58.bin

SHA256: 1a20d612acc4c0edc3d412ed5daefa960692018fe95a064344264e122e00fcde

MD5: 2a899809b55ddcd2aaacdb4c44014aa1

AnywhereUSB8-20.5.38.58.bin

SHA256: 1a52c271a3a4a966e390ec22325801ff19a9142a22fa3fbbeb79204a5e72da959

MD5: c7fd0f53b2ab5dddba05d1de5ee3cc73

AnywhereUSB24-20.5.38.58.bin

SHA256: 25206acfb35e210f19c974d13b4992a6963bbad9de3c420f90155ea1b27be085

MD5: f9f5a6bab651ce18f9e034b2005ade32

FEATURES

1. LDAP user authentication [DALP-192]
2. Add option on the **System → Firmware Update** page in the web UI to have the DAL device query a firmware server for available firmware updates [DALP-481]
3. Add configuration options under **Central management** for a proxy connection to Digi Remote Manager [DAL-3150]
4. Added new **Enable watchdog** configuration option to monitor the connection to Digi Remote Manager, along with options to reboot the device or restart its connection to Digi Remote Manager if the watchdog times out. The default settings are to restart the connection to Digi Remote Manager if the watchdog times out after 30 minutes [DAL-2954]
5. New **application** mode for serial ports to allow full control of serial ports through custom python/shell programs. Also allows additional USB-to-serial adapters to be configured and connected to using the `/dev/serial/<config_key_name>` path [DAL-2807]
 1. **Note:** USB ports configured in application mode are not available to or manageable via the AnywhereUSB protocol or features of this product

ENHANCEMENTS

1. Added the ability to configure DHCP pools larger than /24 subnets [DAL-2864]
2. Add a **statusall** option to the **show ipsec** CLI command to display verbose IPsec status [DAL-2711]
3. Use modem PDP context 1 when an AT&T SIM is inserted to match new requirements from AT&T [DAL-3093]
4. Added Python HID module to allow the DAL device to control PSUs via Python programs [DAL-2092]
5. Allow network analyzer to be configured to monitor any network interface instead of just wired Ethernet ports [DAL-2146]
6. Added option to **ping** CLI command to ping a broadcast address [DAL-2571]
7. Added new health metric to report the interface used by the DAL device for its configured IPsec tunnels [DAL-2710]
8. Added new health metric to report the LTE SNR value of the modem(s) on the DAL device [DAL-2904]
9. Limit metrics upload to no more than 2 per minute if backlogged [DAL-2870]
10. Added new **Locally authenticate CLI** configuration option to control whether a user is required to provide device-level authentication when accessing the console of the device through Digi Remote Manager. Default is to allow console access without providing device-level authentication, since the user is already logged in and authenticated through Digi

- Remote Manager [DAL-1510]
11. Report device SKU in RCI response to Digi Remote Manager [DAL-2940]
 12. Add wldata APN to fallback list [DAL-3182]
 13. Improved recovery of Telit modem firmware updates should the update get interrupted [DAL-2984]
 14. Fixed spelling of **System utilization** chart on Intelliflow page in the local web UI [DAL-2260]
 15. Added new **Health sample upload window** debug configuration option to provide a delay window/jitter when uploading health metrics to Digi Remote Manager (default 2-minutes) [DAL-2607]
 16. Commonize the format and naming of rx/tx health metrics reported to Digi Remote Manager [DAL-2896]
 17. Add IPv6 options to **traceroute** CLI command [DAL-2618]
 18. Add count of bytes transmitted and received to the output of the **show network interface X** CLI command [DAL-2980]
 19. Updated **mmcli-dump** command used when generating a support report to only run its list of AT commands on the cellular modem once [DAL-3013]
 20. Updated placement of the **Apply** button on the **Device Configuration** page of the web UI to account for usability on smaller screens and keep it always visible when scrolling [DAL-3029]
 21. Display the secondary/alternate firmware image version as the **Alt. Firmware Version** in the output of the **show system** CLI command [DAL-3057]
 22. Retain modem firmware files in the event that the firmware upgrade was interrupted [DAL-2856]
 23. Renamed OpenVPN server **device type** configuration options to clarify which options are OpenVPN managed versus device-only [DAL-2857]
 24. Changed the **Idle timeout** configuration settings for remote-access serial ports to use to *blank* instead of *0s*, to better match the format of the **Idle timeout** option for user login sessions [DAL-2623]
 25. Added a 5-second wait time between setting LTE band configuration updates on a Telit modem and rebooting the modem to apply the configuration change [DAL-2972]
 26. Add support for AES_GCM family of IPsec ciphers [DAL-2715]
 27. Increased minimum password complexity to at least 10 characters containing at least one uppercase letter, one lowercase letter, one number, and one special character [DAL-3491]
 1. Note: Devices that were running older firmware that had user passwords that do not meet these minimum requirements after upgrading to 20.5.38.58 will still be able to use that password to authenticate with the device. However, if the user attempts to update user's password in the DAL device's configuration settings after upgrading to 20.5.38.58, the updated password must comply with the new minimum requirements

BUG FIXES

1. Fix VRRP crashes by upgrading keepalived to version 20.0.20 (bug affects firmware versions 20.2.x) [DAL-3181]
2. Prevent IPsec tunnel from being setup if its local network/interface is down (bug affects firmware versions 20.2.x and older) [DAL-2336]
3. Fixed rare issue where the cellular modem could not initialize after resetting the modem (bug affects firmware versions 20.2.x and older) [DAL-1409]
4. Update analyzer to continue running even if the users SSH session ends (bug affects firmware versions 20.2.x and older) [DAL-2154]
5. Prevent re-uploading of invalid health metrics data if Digi Remote Manager sends a

- response that the contents of the health metrics are invalid (bug affects firmware versions 20.2.x and older) [DAL-2868]
6. Fixed timing issue where an IPsec tunnel configured to be built through a specific interface would not be brought down properly if that network interface went down (bug affects firmware versions 20.2.x and older) [DAL-3023]
 7. Fixed issue preventing backup IPsec tunnel from being established when primary/preferred tunnel was down (bug affects firmware versions 20.2.x) [DAL-3024]
 8. Fixed intermittent reporting issue where web UI and CLI would list the modem as registered when it was actually connected (bug affects firmware versions 20.2.x and older) [DAL-2329]
 9. Fixed failing SureLink IPv6 ping tests (bug affects firmware versions 19.11.x through 20.2.x) [DAL-2488]
 10. Fixed issue with applying policy-based routes to incoming packets from the Internet (bug affects firmware versions 20.2.x and older) [DAL-2589]
 11. Fixed bug preventing passthrough mode from functioning if multicast was also enabled (bug affects firmware versions 20.2.x and older) [DAL-2709]
 12. Fixed rare issue with not receiving a SCEP certificate from the server due to timing issues between requesting the certificate with a private key and when that certificate can be downloaded (bug affects firmware versions 20.2.x and older) [DAL-2850]
 13. Fixed error displayed in **show modem** CLI output when modem was not connected (bug affects firmware versions 20.2.x and older) [DAL-2959]
 14. Fixed bug preventing local configuration backups if the configuration directory contained files or directory paths longer than 100 characters (bug affects firmware versions 20.2.x and older) [DAL-3137]
 15. Fix non-working custom DHCP options (bug affects firmware versions 20.2.x) [DAL-3071]
 16. Fix corrupted configuration schema settings after issuing a **config revert** CLI command (bug affects firmware versions 19.8.x through 20.2.x) (bug affects firmware versions 20.2.x and older) [DAL-3194]
 17. Fixed issue where IPsec tunnel is built through default route instead of the configured local interface (bug affects firmware versions 20.2.x) [DAL-2889]
 18. Removed unsupported LED options listed for LR54 units in their digidevice.led Python module options (bug affects firmware versions 20.2.x) [DAL-3250]
 19. Removed empty, blank row from **Filesystem** page in the web UI when listing the contents of an empty directory (bug affects firmware versions 20.2.x and older)
 20. Fixed issue preventing users from downloading the ovpn client configuration file from the web UI on the Chrome browser (bug affects firmware versions 20.2.x and older) [DAL-3262]
 21. Prevent interruptions to QCDM/QXDM port on Sierra modems caused by ModemManager interaction [DAL-3469]
 22. Fixed bug preventing dual-APN connectivity with AT&T SIMs and Sierra modems [DAL-3586]
 23. Fixed bug in USB drivers/setup caused by multiple **set configuration** operations run by the Linux kernel [AWG3-2302]

SECURITY FIXES

The highest level vulnerability that has been fixed in this release is listed as a High CVSS score of **7.5**

1. Update to openssl-8.2p1 (CVE-2019-6111 – CVSS Score: 5.8) [DAL-2860]
2. Fixed user escalation exploit through **cloud.drm.sms** configuration option (CVSS Score:6.0 Severity:Medium Matrix: [AV:L/AC:L/PR:H/UI:N/S:U/C:H/I:H/A:N](#)) [DAL-2887]
3. Fixed user escalation exploit through **Label** configuration setting for serial ports (CVSS Score: 6.0 Severity: Medium Matrix: [AV:L/AC:L/PR:H/UI:N/S:U/C:H/I:H/A:N](#)) [DAL-3011]
4. Fixed password exploit through web token (CVSS Score: 5.6 Severity: Medium Matrix:

[AV:L/AC:H/PR:H/UI:R/S:U/C:H/I:H/A:N](#)) [DAL-3069]

5. Update StrongSwan to 5.8.3 [DAL-2866]
6. Updated iputils to s20190709 and traceroute to version 2.1.0 [DAL-2338]
7. Upgrade Linux kernel to version 5.6 [DAL-2873]
8. Update ipset to version 7.6 [DAL-2853]
9. Update OpenSSL to 1.1.1g (CVE-2020-1967 - CVSS Score – 7.5 HIGH) [DAL-2977]
10. Prevent DOM XSS (cross-site scripting) exploit on **Terminal** page in the web UI (CVSS Score: 4.2 Severity: Medium Matrix: [AV:N/AC:H/PR:N/UI:R/S:U/C:L/I:L/A:N](#)) [DAL-3068]
11. Prevent user escalation exploit through netflash options in web UI (CVSS Score: 4.1 Severity: Medium Matrix: [AV:L/AC:H/PR:H/UI:N/S:U/C:N/I:H/A:N](#)) [DAL-3129]
12. Prevent use-after-free exploit in CLI configuration of OpenVPN (CVSS Score: 5.7 Severity: Medium Matrix: [AV:L/AC:H/PR:H/UI:N/S:U/C:H/I:H/A:N](#)) [DAL-2963]
13. Prevent XSS vulnerability on the **Filesystem** page in the web UI where a directory name with HTML embedded in it would be rendered as HTML rather than plain text (CVSS Score: 4.6 Severity: Medium Matrix: [AV:L/AC:H/PR:H/UI:R/S:U/C:L/I:H/A:N](#)) [DAL-3200]
14. Prevent unauthenticated users from downloading the ovpn client configuration file from the web UI (CVSS Score: 5.6 Severity: Medium Matrix: [AV:N/AC:L/PR:N/UI:N/S:U/C:L/I:N/A:N](#)) [DAL-3133]
15. Removed remote_control service used when receiving remote commands from aView/ARMT/AVWOB in favor of HTTPS secure commands. Vulnerability discovered by Stig Palmquist (CVE pending) [DAL-3460]
16. Add failed login attempts to event log sent to remote syslog servers, if enabled [DAL-3492]

VERSION 20.2.162.162 (March 17, 2020)

This is a **mandatory** release

AnywhereUSB2-20.2.162.162.bin

SHA256: bf4a063872d6bf6cbf1f7ad6aa22df1308553ea297e0b30a3756669af3108cfe

MD5: 773a6f0248bdd887b4d8fde5f2d704a5

AnywhereUSB8-20.2.162.162.bin

SHA256: 50e1a77ffa74cc0663b1d68330aad8d6963d6c83da516263387103208b1b03f5

MD5: be69d10de50907bc32e05f94023f8eb8

AnywhereUSB24-20.2.162.162.bin

SHA256: fe8b91efbfa5d40d44c3d66b7ec8a3ab8953e7d38e26449effcaa636dcf6e347

MD5: 7e6f85b48f8182233e0c39b1e5f8af08

ENHANCEMENTS

1. Add MAC address is support report filename [DAL-2863]
2. Use **ims** instead of **vzwims** APN on Verizon SIMs for proper IMS registration [DAL-2883]
3. Add USB packet capture tools in CLI under the **system usbtrace** command [DAL-2638]

BUG FIXES

1. **1002-CM04/1003-CM11**: Fixed cellular high-speed throughput performance issues caused by CPU slowdown and timing of gathering cellular signal details [DAL-2802]
2. **1003-CM11**: Fixed inability to utilize SIM slot 2 of an device with a Telit LE910c4-NF or LM940 modem when the two SIM slots contained SIMs from differing carriers [DAL-2897 & DAL-2986]
3. Fix health metrics warnings in Digi Remote Manager stating the local filesystem's /opt/ directory was full when it wasn't [DAL-2769]

4. Fixed missing Rx/Tx bytes in **show modem** CLI command output [DAL-2804]
5. Fixed issue preventing multicast packets from being sent through a network bridge [DAL-2774]
6. Fixed auto-reboot after restoring configuration file through local web UI [DAL-2862]
7. Fixed inability to update modem firmware on Sierra EM7511 modules [DAL-2794]
8. Fixed improper modem firmware selection on Telit LM960 module when using a T-Mobile SIM [DAL-2376]
9. Fixed bug causing the configured **Reboot Time** to always occur in UTC instead of local timezone (issue present in older 20.2.162.x firmware versions)[DAL-2859]
10. Fixed bug preventing analyzer from being stopped in the CLI [DAL-2892]

SECURITY FIXES

1. Fix cross-site scripting (XSS) vulnerability on various Status pages in the local web UI [DAL-2818]
2. Fix cross-site scripting (XSS) vulnerability on Configuration page in the local web UI [DAL-2819]
3. Fix cross-site scripting (XSS) vulnerability on Terminal page in the local web UI [DAL-2823]
4. Fix cross-site scripting (XSS) vulnerability on File System page in the local web UI [DAL-2823]
5. Prevent script injection exploit on the Configuration Maintenance page in the local web UI [DAL-2797]
6. Prevent unauthorized read/write access to /opt/config/ and /opt/boot when `Interactive Shell` is disabled [DAL-2865]
7. Prevent analyzer output from being saved outside of the /etc/config/analyzer directory [DAL-2672]

Version 20.2.162.90 (March 11, 2020)

AnywhereUSB2-20.2.162.90.bin

SHA256: e6f6a76858bfca0af08821c4f68557888d63fe778a8900151bc2340dcbf3fd4b

MD5: 039158e0e2a57a90b7349104b3aa625c

NEW FEATURES

1. Telit LM960 LTE CAT18 modem support [DALP-487]
2. Quectel EC25-AF LTE CAT4 modem support [DAL-1817]
3. [Digi Remote Manager](#) is set as the default portal for all DAL products [DALP-393]
 1. Central management via Digi Remote Manager will not be automatically enabled if you upgrade a device running 19.11.x or older firmware to 20.2.x or newer firmware, but can be enabled if desired. However, if the device running 20.2.x or newer firmware gets reset (e.g. if someone presses the Erase button on the device, or erases its config through the web UI or Admin CLI), the device will sync with Digi Remote Manager by default.
4. Added SureLink™ default connectivity tests on all WAN interfaces [DALP-402]
 1. SureLink tests (previously referred to as **Active Recovery**) will not be enabled by default if you upgrade a device from 19.11.x or older DAL firmware to 20.2.x or newer firmware, but can be enabled if desired. However, if the device running 20.2.x or newer firmware gets reset (e.g. if someone presses the Erase button on the device, or erases its config through the web UI or Admin CLI), the default SureLink tests **will be enabled** as part of the default settings of the device.
5. New web UI pages added under the **System** drop-down with enhanced serial details and configuration [DALP-465]
6. Support for firmware/OTA updates on Quectel modems [DALP-419]
7. AT&T LWM2M support for Telit LM940/LM960 modems [DAL-2476]

ENHANCEMENTS

1. Prevent access to web UI until HTTPS is ready [DAL-603]
 1. Until the SSL cert is generated, users trying to access the web UI via standard http will receive a redirect page stating that the cert is generating. Once the SSL cert is generated, users accessing the web UI via standard http will be automatically redirected to the https link
2. Show multiple bands for Telit modems if carrier-aggregation is supported and active [DAL-2624]
3. Added additional Telit-specific AT commands to mmcli-dump of support report
4. Improved Role-based access on local web UI, SSH, and remote access [DALP-415]
 1. Includes new configuration options:
 2. **Allow shell** - NOTE if this options is disabled and subsequently re-enabled, the DAL device will **reset to default settings**
 1. **If disabled, the following changes are implemented**
 - a) Forced all custom scripts to be sandboxed.
 - b) Script sandboxing uses a tighter profile that prevents /bin/sh access.
 - c) Sandbox custom firewall scripts to a profile that only allows **iptables/ipset/arptables/ip** commands and access to /proc and /sys files. Basically all things firewall related but very locked down. The commands are still run in the shell, but no external commands are available, so the script is limited to basic loops and variable access and no escaping.
 2. Under each user group under **Authentication → Groups** in the configuration settings:
 1. **Admin access**
 2. **Access level**
 3. **Interactive shell access**
5. New default break sequence **~b** for serial connections [DALP-253]
6. Report MCC/MNC/CID/LAC values in health metrics to Digi Remote Manager [DAL-2502]
7. Add digicpn.gw12.vzwentp Verizon APN to fallback list [DAL-2283]
8. Change default OpenVPN Certificate Issuer details from Accelerated to Digi [DAL-2449]
9. Change default SSL certification from Accelerated to Digi [DAL-1336]
10. Dual-APN support on Sierra EM7511 modem [DAL-2311]
11. Include AT#RESETINFO and Quectel-specific AT commands in support report [DAL-2394]
12. Rename **Configuration Management** page under the System section of the web UI to **Configuration Maintenance** [DAL-2549]
13. Added link under **System** drop-down in web UI to download the support report
14. Update the **Digi Remote Manager** link under the **System** drop-down in the web UI to open in a new tab [DAL-2294]
15. Update the **Authentication → Idle** timeout setting to have a default value of 10-minutes (previously the default was blank) [DAL-2292]
16. Send up to 4 IPsec tunnels' details as health metrics reported to Digi RM [DAL-1476]
17. Change the default behavior of the **SIM failover alternative** settings from **None** to **Reset modem** [DAL-2687]

18. Prevent AnywhereUSB 8/24 Plus devices from downgrading to 19.11.x or older firmware
19. Add USB snooping/logging/debug control
20. Increase default max system log size from 1,000 lines to 3,000
21. Renamed **Signal Strength** references to **Signal Quality** [DAL-2707]
22. On the Network Status page of the web UI, add **Interface is up** message in SureLink status details
23. Add **service.qcdm.modem.device** and **service.qcdm.modem.interface_number** config options for specifying QCDM/QXDM port for a modem [DAL-2497]

SECURITY FIXES

1. Update to Linux kernel version 5.4.8
2. Removed plain-text passwords displayed in the output of the **show config** CLI command [DAL-2513]
3. Added backoff timer when maximum number of SSH/UI login retries is exceeded [DAL-2590]
4. Update to Python version 3.6.10 [DAL-2534]
5. Update tcpdump to version 4.9.3 (CVE-2017-16808 CVE-2018-14468 CVE-2018-14469 CVE-2018-14470 CVE-2018-14466 CVE-2018-14461 CVE-2018-14462 CVE-2018-14465 CVE-2018-14881 CVE-2018-14464 CVE-2018-14463 CVE-2018-14467 CVE-2018-14463 CVE-2018-10103 CVE-2018-10105 CVE-2018-14879 CVE-2018-14880 CVE-2018-16451 CVE-2018-14882 CVE-2018-16227 CVE-2018-16229 CVE-2018-16301 CVE-2018-16230 CVE-2018-16452 CVE-2018-16300 CVE-2018-16228 CVE-2019-15166 CVE-2019-15167) [DAL-2611]
6. Update libpcap to version 1.9.1 [DAL-2611]
7. Update e2fsprogs to version 1.45.5 (CVE-2019-15161 CVE-2019-15162 CVE-2019-15163 CVE-2019-15164 CVE-2019-15165 CVE-2017-16808) [DAL-2611]
8. Update openvpn to version 2.4.4 (CVE-2017-12166) [DAL-2614]
9. Update libldns to version 1.7.1 (CVE-2017-1000231 CVE-2017-1000232) [DAL-2613]
10. Update libxml2 to version 2.9.10 (CVE-2018-9251 CVE-2018-14567) [DAL-2612]
11. Restrict /etc/config/ to admin-only users [DAL-1396]
12. Remove plaintext password from RADIUS debug logs [DAL-2640]
13. Prevent Framebusting JavaScript click-jacking [SEC-494]
14. Prevent users from gaining elevated shell access through custom scripts [DAL-2628]
15. Update libcurl to version 7.69.0 (CVE-2019-15601) [DAL-2732]
16. Update pppd to version 2.4.8 (CVE-2020-8597) [DAL-2732]
17. Fix elevated root access through custom scripts when no-shell is enabled [DAL-2628]
18. Obfuscate sensitive device configuration settings [DAL-1388]

BUG FIXES

1. Fixed bug where SureLink™ DNS tests took longer than the configured timeout to complete [DAL-2702]
2. Fixed SSL validation bug preventing modem OTA updates [DAL-2547]
3. Fixed bug where newly-created network Bridges would not be listed as options under the Device drop-down for network interfaces [DAL-2575]

4. Fixed bug where the primary/active interface was not reported correctly to Digi aView when the DAL device was configured for load-balancing between two WAN interfaces [DAL-2568]
5. Fixed bug where a device configured with multiple SSH keys would only honor the last SSH key in the list [DAL-2506]
6. Display the active cellular band for Quectel modems [DAL-2298]
7. Fixed bug where the web UI would display bytes transmitted/received for network interfaces as **N/A** [DAL-2295]
8. Fixed bug where the web UI wouldn't show IP information for client devices connected to an OpenVPN server running on the DAL device [DAL-2251]
9. Fix formatting output of **show config** CLI command when the configuration settings contained an array [DAL-2594]
10. Fix bug when adding a new element to an array in the **config** mode of the CLI [DAL-2594]
11. Fix bug where CLI ping and traceroute commands would ignore any interface specified in the command [DAL-2605]
12. Fix bug where SureLink™ default tests would continue to pass if cellular modem lost its active data connection [DAL-2609]
13. Fix a bug handling certificate files with spaces
14. Fixed padding issue with downloading SCEP CA certificates [DAL-2212]
15. Fixed rare issue with passthrough ancillary DNS not resolving if **ancillary DNS redirect** issue was disabled
16. Fixed issue with active serial logins when a serial-related configuration change was applied to the DAL device [DAL-2696]
17. Remove accns certs
18. Improve sorting order in AnywhereUSB Manager
19. Remove custom serial web page from AnywhereUSB Products
20. Fix bug preventing AnywhereUSB Plus devices from connecting through Gigabit Ethernet switches
21. Fix non-working **Find Me** feature in web UI
22. *AWUSB 8/24 Plus*: Fixed timezone offset when saving time to onboard RTC
23. *AWUSB 8/24 Plus*: Fix bug where devices with an internal realtime clock would not adjust their local time to the configured timezone
24. *AWUSB 8/24 Plus*: Fix ECDHC bus routing
25. Fixed output of **show modem** CLI command when cellular modem re-initializes
26. Fix potential initialization issues after updating firmware [DAL-2762]

VERSION 19.11.72.85 (January 20, 2019)

Initial Release with new User Interface

82004379_19.11.72.85_AW02_EOS_B.bin

SHA256: d6bef8ec97d55d13b9481b50fe1d2c92516b907eb127241bf1a9b8ce7d229109

MD5: f8c8178c5903da4b1eb9553708972f39

882004378_19.11.72.85_AW08_EOS_b.bin

SHA256: 4cfc5c331352bf0901dcc573e0a944457356c7b10e0f3c1137bfa6eb757e43ae

MD5: 6f8c7e2b3987fc4c4f62dae2a77572b9
82004377_19.11.72.85_AW24_EOS_B.bin
SHA256: 624828734761f1f537ee56092aa012fe02d5f09053627203c0a6e0cc6e533b54
MD5: 0c6949aff8b1c5107cf01a3dc8a91af6

New Features

- Cellular support is now available via the Digi Core Module
- VPN
 - IPsec with certificate and pre-shared key authentication
 - HW encryption for IPsec
 - OpenVPN
 - GRE
- Digi Remote Manager
 - Remote Management
 - Device Health Metrics
- IPv4/IPv6
- Routing
 - Static Routes
 - Policy based Routing
 - Routing services (BGP, OSPF, RIP, IS-IS)
 - Multicast
- Port Forwarding
- Packet Filtering
- Packet Analyzer